

SURVEY RECORD

REMONUMENTATION CORNER

FEB 27 1995

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

95-05

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. _____ 24N N. 6E S., R. _____ E. W.	K10
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S., R. _____ E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

STATE OF MICHIGAN
IOSCO COUNTY
FILED

29 NOV 95 12:18 P.M.

BONITA H. COYLE
REGISTER OF DEEDS

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on April, 24 1995, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
1/4 Corner common to Sections 25 and 26 of T24N R6E

- 1845 GLO survey by James Mullett Cedar 8" for the corner
- 1909 survey by Fargo Eng. Co. Did not find any evidence of the 1845 survey, (1) Balm of Gilead 14 S12-45W 19.5 links, (2) Balm of Gilead 12 N84-30E 48.5 links
- 1927 GLO Dependent Resurvey by Guy Veal Did not find evidence of Fargo so set a 1"x36" iron pipe w/ brass cap, (3) Poplar 4 N58E 10 links, (4) Poplar 4 S76W 11links

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I searched for and could not find any evidence of the GLO brass cap monument or witnesses 1 through 4. I did find a key ring within 1 foot of the calculated location for this corner. I believe the monumnet has been removed. I recovered this corner by single proportional measurement between the SE 26 and the NE 26. I found this line to measure 5349.52 feet when compared to the Dependent Resurvey distance of 5351.28 feet.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 1/4 Corner common to Sections 25 and 26 of T24N R6E**
- I set a 5/8" x 24" rebar with aluminum cap at the calculated location and since no reliable witnesses were available within a reasonable distance I set several rebar to aid in recovery.
- Rebar 1/2"x 24" N8E 34.74 feet
- Rebar 1/2"x 24" N83E 40.99 feet
- Rebar 1/2"x 24" S60W 47.41 feet
- Fiberglass Post South 0.6 ft.

ACCEPTED BY THE IOSCO COUNTY
SURVEY PEER GROUP AS THE
OFFICIAL CORNER UNDER P.A.
345 OF 1990 AT A MEETING
HELD ON 10-31-95

James H. Granger


SIGNED BY Patrick R. Leemon DATE May 30, 1995

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

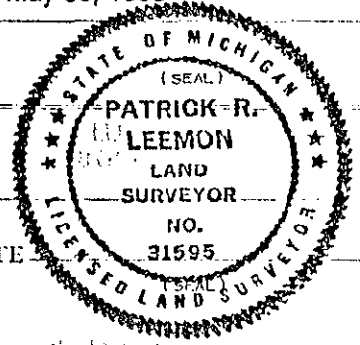

SURVEYOR'S MICHIGAN REGISTRATION NO. _____