

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	(IRON COUNTY) LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 41 N. R. 32 X W.	G-1
2. PROPERTY CONTROLLING IN SECTION 4 _____	T. 41 N. R. 32 X W.	7
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner G1 (Section Corner 3, 4, 33, & 34, T41-42N, R32W):
 Black Ash post (Not found. See B for subsequent monument.)
 W. Pine 18 N 8E 26 (Not found. Aspen 13 N32 1/2°W (mag.) 6.9 ft.)
 Hemlock 14 N52W 22 (Not found. Aspen 7 S25 1/2°W (mag.) 9.6 ft.)
 Aspen 9 S39°E (mag.) 15.6 ft.

Corner 7 (North 1/16 corner between Sections 3 & 4, T41N, R32W):
 Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
Corner G1: On 4/28/78 rewitnessed a 1" I.D. x 36" iron pipe with 4" aluminum cap as set by the undersigned on 5/14/71, proportionately on line between section corners 80.08 ch. to E and to W. Position checks almost exactly with stream crossing 5.50 ch. N and with call to ascend south from corner, as mentioned in original field notes. Rewitnessing necessitated by death and/or removal of previous NBT's.

Corner 7: Established 4/26/78 on line between Sec. Cor. 20.0155 ch. N and 1/4 cor. 20.0155 ch. S.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner G1: 1" I.D. x 36" iron pipe with 4" aluminum cap
 W. Spruce 5 S16°E (mag.) 18.7 ft. "S3, NBT"
 Red Oak 4 N 8°W (mag.) 19.4 ft. "S33, NBT"
 1" iron pipe N35°07'W (true) 10.88 ft.
 Declination 10°40' West. (Previous corner record gives declination as East, but is in error.)

Corner 7: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap
 Red Oak 6 N50°E (mag.) 6.9 ft. "1/16S, BT"
 Red Oak 6 N85°W (mag.) 20.8 ft. "1/16S, BT"
 Declination 1°45' East

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____


(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE January 10, 1979
CHIEF OF SURVEY PARTY
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
 Michigan Department of Natural Resources

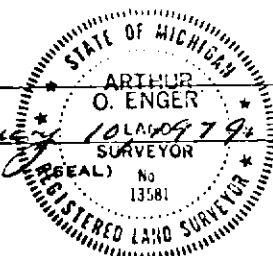

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581