

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> ^{N.} S. R. <u>31</u> ^{EX} W.	<u>A1</u>
2. PROPERTY CONTROLLING IN SECTION <u>6</u>	, T. <u>42</u> ^{N.} S. R. <u>31</u> ^{EX} W.	<u>3</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ ^{N.} S. R. _____ ^{E.} W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner A1: Tamarack post (Not found. Found 2"x52" iron pipe in place.)
 Tamarack 5 N20E 10 (" " No subsequent accessories found.)
 Tamarack 7 S45W 17 (" " " " " " " ")

Corner 3: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner A1: Witnessed and replaced monument as found on 7/9/74. Corner agrees substantially with other corners to N, S, and W of it and with margin of a small lake 4.55 ch. to E. (Record distance: 4.82 ch.) Person who placed pipe and date of placement not known.

Corner 3: Established 5/2/72 proportionately on line between 1/4 cor. 20.081 ch. S and Sec. Cor. 19.880 ch. N. Corner falls on W margin of a small lake, in accordance with original field notes.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner A1: 1" I.D. x 39" iron pipe with 3½" aluminum cap.
 Tamarack 10 S15½°E (mag.) 36.7 ft. "S 6, NBT"
 W. Pine 7 N33°W (mag.) 14.1 ft. "S36, NBT"

Corner 3: 1" I.D. x 36" iron pipe with 3½" aluminum cap.
 Red Pine 12 S85°W (mag.) 17.4 ft. "1/16S, BT"
 Red Pine 6 S 5°W (mag.) 24.2 ft. "1/16S, BT"

Variation at this corner about 1°30' East.

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE November 26, 1974

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR
Arthur O. Enger
 Michigan Department of Natural Resources

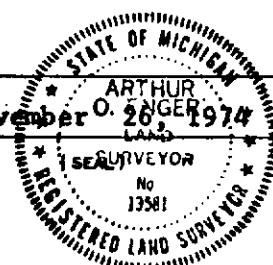

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581