

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> N. <u>31</u> E. <u>W.</u>	<u>I10</u>
2. PROPERTY CONTROLLING IN SECTION <u>26</u>	T. <u>42</u> N. <u>31</u> E. <u>W.</u>	<u>3 & 10</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. <u>W.</u>	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner I10: Hemlock post	(Not found. No subsequent monuments found.)
Hemlock 12 N28E 25	(" " " " accessories ")
Hemlock 14 S37W 28	(" " " " " ")

Corners 3 & 10: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner I10: Re-established 5/9/73 on line between Sec. Corners 40.080 ch. to N and to S. Corner is on W edge of traveled portion of county road, with top of monument about 4 inches below ground surface.

Corner 3: Established 5/9/73 on line between Sec. Cor. 20.040 ch. N and 1/4 cor. 20.040 ch. S.

Corner 10: Established 6/14/74 on line between Sec. Cor. 20.040 ch. S and 1/4 cor. 20.040 ch. N. Top of monument is about 6" below road surface.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner I10: 1" I.D. x 36" iron pipe with 4" aluminum cap.
 Red Maple 6 N71°E (mag.) 55.3 ft. "1/4S, NBT"
 Red Maple 5 N74°W (mag.) 26.4 ft. "1/4S, NBT"
 W. Spruce 8 S42°E (mag.) 78.2 ft. "1/4S, NBT"

Corner 3: 1" I.D. x 36" iron pipe with 4" aluminum cap.
 Red Pine 20 N60°W (mag.) 19.6 ft. "BT"
 White Pine 16 N51°E (mag.) 41.5 ft. "BT"
 Distances are horizontal.

Corner 10: 1" I.D. x 24" iron pipe with 3 1/2" aluminum cap.
 Red Maple 7 S45°W (mag.) 49.4 ft. "BT"
 W. Spruce 10 N47°E (mag.) 40.6 ft. "BT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE July 31

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR
Arthur O. Enger
 Michigan Department of Natural Resources

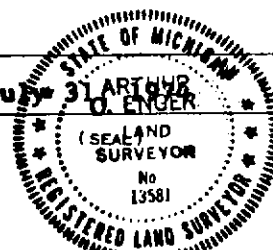

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581