

66

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Iron

Located in:

Corner Code #

1. Public Land Survey	T	42N	R	31W	612
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S	33	T	42N R 31W	12
	S	33	T	42N R 31W	8
3. Miscellaneous Property in Sec.	S		T		
	S		T		

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

8 September 26, 1994  
12 September 22, 1994  
612 September 22, 1994

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2												
3												
4												
5												
6												
7												
8												
9												
10												
11												
12												
13												

A. Description of original monument and accessories and/or subsequent restoration:

(612) Quarter corner common to Sections 33-34. Corner established in 1849 by John Burt as follows: Set cedar qr Sect. post. Cedar 12 NW 13, Hemlock 14 S51E 21'. Corner re-monumented in the 1940's by Wisconsin Michigan Power Company as follows: No evidence. Set pipe marker, 4" Pop. South 19.0". Found no subsequent record.  
(12-Sec. 33) South 1/16 corner Section 33. Corner not established in the original survey. Wisconsin Michigan Power Company records show that the corner was monumented with a 2" iron pipe WMPCO monument in the 1940's.  
(8-Sec. 33) West 1/16 corner, Section 33. Corner not established in the original survey. Established in the 1940's by Wisconsin Michigan Power Company as follows: 1/8 cor. Set pipe marker, 4" Maple S04E 21.5', 3" Maple S03W 12.0', 5" Maple N03W 23.0". Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(612) Found the WMPCO monument - a 2" capped iron pipe, in good condition. The NBT poplar was not recovered. Made no further attempt to verify the WMPCO position. Left the monument in place and marked 4 new witnesses as described below.  
(12-Sec. 33) Found no monumentation at the corner position. Recovered and did not accept the WMPCO monument - a 2" iron pipe with 3 1/2" dia. brass WMPCO cap stamped "1/8 cor" - 298.10' south and 5.35' east of the corner position. Established the corner on a straight line between quarter corner 1319.71' south and Center of Section 1319.71' north. At the position for the corner, I placed a 1" I.O. 132" iron pipe capped with a 4" dia. cast aluminum NDNR tablet, appropriately stamped.  
(8-Sec. 33) Found the WMPCO monument - a 2" dia. iron pipe capped with a 3 1/2" brass WMPCO cap - and one remaining NBT: 12" Maple N01W 23.0". Determined the monument to be 1.93' north and 2.41' east of being midway and on a straight line between quarter corner west and Center of Section east. Both adjacent corners are WMPCO monuments. This 1/16 corner has been used by others to subdivide the NW 1/4 of Section 33. Accepted the monument as a careful and faithful determination of the position of the corner. Left the monument in place and marked 4 witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(612) Found 2" I.O. x unknown length iron pipe capped with a 3 1/2" dia. brass WMPCO cap. Blazed and scribed the following new bearing trees:  
8" Spruce S07W 46.2' "1/4S NBT"  
5" Spruce N72E 23.2' "1/4S NBT"  
4" Spruce S56E 38.0' "1/4S NBT"  
14" Aspen N40W 7.1' "1/4S NBT"  
Bearings are magnetic.

(12) Set 1" iron pipe with 4" NDNR cap. Blazed and scribed the following bearing trees:  
12" Cedar S33E 6.8' "1/16S BT"  
16" Cedar S16W 9.8' "1/16S BT"  
14" Cedar N33W 22.3' "1/16S BT"  
10" Cedar East 30.5' "1/16S BT"  
Bearings are magnetic.

(8) Found 2" dia. x unknown length iron pipe with 3 1/2" dia. brass WMPCO cap. Blazed and scribed the following bearing trees:  
12" Maple N01W 23.0' "1/16S BT"  
5" Maple N44E 29.9' "1/16S BT"  
7" Maple S54E 37.7' "1/16S BT"  
10" Maple S09W 27.1' "1/16S BT"  
Bearings are magnetic.


Signed by

*Stephan J. Szyszkoski*

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources

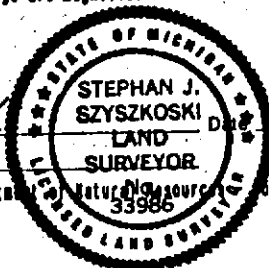

10-10-94

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 29, 1971  
REVISED MAY 14, 1979  
REVISED JAN., 1983