

SURVEY & REMONUMENTATION

FORM NO. 985-A



Stock No. 26273

MAR 19 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>42N</u> R <u>R33W</u>	<u>I-12</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

IRON COUNTY
MICHIGAN
RECEIVED FOR RECORD

96 DEC 23 AM 9:16
L.C. Records L. 7, P. 77
Gilbert Stiles
REGISTERED DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Quarter Corner between Sections 34 & 35, T42N R33W

I, Gary L. Pisoni, in a field survey on November 20, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Guy H. Carleton, U.S. Deputy Surveyor in 1851.
Original corner: Wood Post
Original bearing trees:
White Pine 14" S 47° W 21 links (13.86 feet)
White Pine 14" N 57° E 16 links (10.56 feet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original corner evidence found.

Corner located in a field. Found a single fence post which has been used as the Quarter corner position, but is too far out of position to be acceptable.

I set the Quarter corner by single proportionate measurement between the Northeast and Southeast Section corners of Section 34, T42N R33W.


Corner Record Research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position, I set a 2" diameter by 30" long split base aluminum pipe monument with a 3" cast aluminum cap, stamped to read: Iron County Remonumentation, T42N R33W, 1/4, S-34, S-35, 1996, RLS-27457 from which I established the following new blazed and scribed bearing trees: (all measurements taken to a nail in side of tree)

Rebar	5/8" x 30"	N 40° E	33.13 feet
Rebar	5/8" x 30"	S 44° E	35.11 feet
Steel Sign Post	6'	North	0.90 feet
Steel Sign Post	6'	West	1.07 feet
Wood fence post	10" dia. X 5'	S 35° E	134.08 feet

PEER GROUP APPROVED
Iron Gary L. Pisoni 12-11-96
COUNTY REPRESENTATIVE

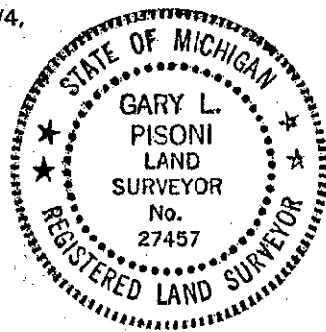

#96-55
Signed by Gary L. Pisoni

Date 12-10-96

Surveyor's Michigan License No. 27457

L. 7 P. 77