

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Iron

(County)	Located in:	Corner Code #
1. Public Land Survey	T 43N R 31W	M2
	T R	
	T R	
	T R	
2. Property Controlling in Section	S 1 T 43N R 31W	7
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

- 4. Lot No _____, Recorded Plat _____
- 5. Private Claims _____

I, Stephan J. Szyszkoski, in a field survey on May 16, 1994, 19____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(M2) Quarter corner common to Section 1 T43N-R31W, and Section 8 T43N-R30W. Original record states: Set Hemlock post, Tamarack 10 S80W S2, Spruce 10 N75W 81. Corner subsequently recorded by Thomas P. O'Brien in 1977 as: Found pipe with Kimberly Clark cap: 6" Spruce N32W 8.2', 8" Spruce S40E 4.4', 8" Spruce S70W 4.4'.
(7-Sec. 1) North 1/16 corner between Section 1 T43N-R31W and Section 8 T43N-R30W. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.


(M2) Found and accepted a 2" dia. iron pipe, pinched on lower end, set by unknown surveyor, presumably long ago. O'Brien's record of K-C monument at this corner seems to be erroneous. Recovered the stump mound remains of both original bearing trees at record bearing and distance, both in advanced stages of decay and no markings visible. The pipe is located at an old fence corner with old wire fences extending to the north and east. An old witness pipe of similar description was found S48W 47.60' from the corner. Replaced the pipe with a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped, firmly set, projecting 12", leaning slightly easterly. The center punch on the cap is marking the corner position. Set the 2" pipe adjacent on the west side. Remeasured the 1977 NBTs and set one new NBT as described below.
(7-Sec. 1) Found no monumentation at the corner position. Established the corner at 20 chains proportionate to the original record (1330.85') north of the Quarter corner common to Sections 1-8 and on a straight line between the Quarter corner and the Township corner (1290.07') to the north. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped, projecting 12".

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(M2) Set 1" pipe with 4" MDNR cap. Found measuring nails in side blazes in the following trees (all marked with a small face blaze):
6" Spruce S20E 4.34'
4" Spruce S55W 4.88'
7" Spruce N30W 8.28'
Added the following, marked in a similar manner:
7" Spruce N53E 12.81'.

(7) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following bearing trees:
9" Sugar S73E 4.1' "1/16S BT"
16" Hemlock S17W 47.4' "1/16S BT"
8" double Sugar N59W 18.0' "1/16S BT"
8" Sugar N39E 41.5' "1/16S BT"
1.5" I.D. iron pipe N58E 54'
Old N-S barbed wire fence is 43' east
Set a 2" squared sugar post adjacent.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

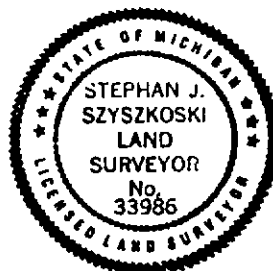

Signed by Stephan J. Szyszkoski Date 6-16-94
Surveyor's Michigan License No. 33986