

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>X</u> , R. <u>33</u> <u>X</u> W.	A1
2. PROPERTY CONTROLLING IN SECTION <u>6</u>	, T. <u>43</u> N. <u>X</u> , R. <u>33</u> <u>X</u> W.	1 & 3
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____, R. _____ E. _____ W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner A1: Cedar post (Not found. No subsequent monuments found.)
 Hemlock 34 S53W 25 (Possibly found. No subsequent accessories found.)
 Fir 12 N58E 52 (Not found. No subsequent accessories found.)

Corners 1 & 3: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner A1: Re-established 10/30/73 proportionately from original corners 79.597 ch. S and 39.591 ch. E. The township boundaries for 4½ miles to S and 4 miles to E were run, and several original corners identified on them, from which an apparent index error was derived. The index error for each twp. boundary was applied to the record distances to original corners 1 mile S and 1/2 mile E, and the corner established at the intersection point. Distance N to Paint River is 36.74 ch., the record being 36.87ch. There is the outline of a large tree, well-rotted and assimilated into the soil, at a position corresponding to the Hemlock 34 BT.
 Corner 1: Established 7/10/74 proportionately on line between 1/4 cor. 19.955 ch. E and Sec. Cor. 19.681 ch. W.
 Corner 3: Established 6/28/74 proportionately on line between 1/4 cor. 20.055 ch. S and Sec. Cor.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monuments for all three corners: 1" I.D. x 36" iron pipe with 3½" aluminum cap. 19.433 ch. N.

Witnesses for Corner A1: Sugar Maple 8 N76°E (mag.) 22.6 ft. "S31, NBT"
 Red Maple 8 S11°E (mag.) 20.5 ft. "S6, NBT"
 Elm 11 N42½°W (mag.) 41.1 ft. "S36, NBT"
 Witnesses for Corner 1: Sugar Maple 9 N52°E (mag.) 17.4 ft. "1/16S, BT"
 Sugar Maple 8 N66°W (mag.) 3.0 ft. "1/16S, BT"
 Witnesses for Corner 3: Triple Cedar 6 N50°E (mag.) 7.5 ft. "1/16S, BT"
 Elm 6 N24°W (mag.) 16.4 ft. "1/16S, BT"

Note: This monument is angled to N, because of large rocks at point; punch mark on cap is over the point.


SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger CHIEF OF SURVEY PARTY DATE September 23, 1975
MICHIGAN REGISTERED LAND SURVEYOR

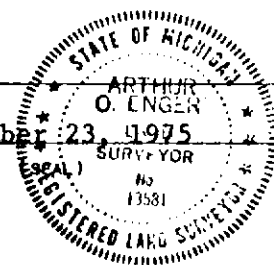

Arthur O. Enger

Michigan Department of Natural Resources

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581