

**SURVEY &  
REMONUMENTATION**

JAN 1 2 1996

**COMMISSION**

**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

IRON COUNTY  
MICHIGAN  
RECEIVED FOR RECORD

95 DEC 15 PM 2:21  
LC Records L 6, P. 407

*William Stebbins*  
REGISTER OF DEEDS

For corners in

Iron (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>34W</u>	<u>B-1</u>
	T <u>44N</u> R <u>34W</u>	<u>B-13</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Quarter Corner 31 & 6 T44-43N R34W

I, Gary L. Pisoni, in a field survey on October 13, 19 95  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned  
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the  
current manual of survey instructions of the United States Department of the Interior, Bureau of Land  
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5  
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a  
Court of Law; established, re-established, monumented, re-monumented, recovered, found as  
expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by William A. Burt, U.S Deputy Surveyor in 1846.

Original corner: Spruce Post

Original bearing trees:

Cedar	16"	N 09° E	22 links (14.52 feet)
Cedar	10"	N 80° W	6 links ( 3.96 feet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original corner evidence found. Corner position marked by an iron pipe located in a county gravel road, Iron pipe located on a fence line running South and West. GLO distance along section line checks good East and West. I accept the iron pipe as the best available evidence for restoring the corner position. Monument is 6 inches below road bed surface.

Research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position, I set a 2" diameter by 30" long split base aluminum pipe monument with a 3" cast aluminum cap, stamped to read: Iron County Remonumentation, T44N, R34W, S-31, 1/4, S-6, T43N, 1995, RLS- 27457 from which I established the following new accessories for the Quarter corner:(all measurements taken to a nail in side of Utility Pole)

Rebar	5/8"x30"	S 07° E	23.95 feet
Rebar	"	S 55° W	22.04 feet
Utility Pole w/transformer		N 68° W	37.68 feet
Steel Sign Post		S 16° W	12.50 feet


PEER GROUP APPROVED

*Gary L. Pisoni 12-14-95*  
COUNTY REPRESENTATIVE

Signed by Gary L. Pisoni

Date 11-30-95

Surveyor's Michigan License No. 27457

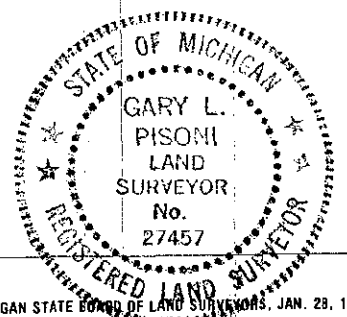

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN. 1983