

**SURVEY &
REMONUMENTATION**

JAN 19 1999

SECTION

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

corners in

<u>Iron</u> (County)	Located In:	Corner Code #
Public Land Survey	<u>T 43N R 34W</u>	<u>E-5</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
1. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

IRON COUNTY
MICHIGAN
RECEIVED FOR RECORD

98 DEC 28 AM 11:10

L.C. Records: L. 7, P. 233

Gilbert Stebbins
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

1. Lot No. _____, Recorded Plat _____
2. Private Claims _____

Section Corner Sections 8, 9, 17, 16, T43N, R34W

Gary L. Pisoni, in a field survey on October 20, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned on lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1. Description of original monument and accessories and/or subsequent restoration:

Original corner established in 1851 by Guy H. Carleton, U.S. Deputy Surveyor.

Original Corner; Wood Post
Original Bearing Trees:

Sugar	14"	S 50° W	23 lks (15.18 feet)
Sugar	12"	N 60° E	36 lks (23.76 feet)

3. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.

Found a P.K. nail marking the SE corner of the Assessor's Plat of Sunset Lake Summer Resort. Corner has been in existence for over 20 years and has been used for many surveys on the South side of Sunset Lake.

P.K. nail is in line with a rock fence line running East and South.

I accept the P.K. nail as the best available evidence for restoring the corner position. Distances to adjoining corners East/West and South are consistent with GLO Distances.

Corner record research on file with County Representative.

PEER GROUP APPROVED
Gary L. Pisoni 12-24-98
COUNTY REPRESENTATIVE

2. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Set one (1) reference monument being a 5/8" diameter by 30" long rebar pin with a 3" diameter aluminum cap stamped as follows: Iron County Remonumentation, T43N, R34W, R.M., S-8, S-9, S-17, S-16, S 03° W, 30.00', 1998, RLS 27457 from which I established the following new blazed and scribed bearing trees: (All measurements taken to a nail in side of tree)

R.M.	5/8" x 30" rebar	N 03° E	30.00 feet
Utility Pole	#67B	S 87° E	59.60 feet
Basswood clump	8"	S 06° E	88.97 feet
Utility Pole	#66B	S 85° W	43.30 feet
Steel sign post		N 03° E	31.35 feet

38-16 Signed by Gary L. Pisoni Date 12-21-98

Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
NO. REVISED MAY 18, 1975
27457 REVISED JAN., 1983
REVISED OCT., 1995

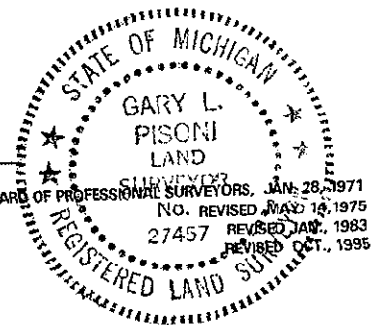

L. 7 P. 233