

**SURVEY &
REMONUMENTATION**

JAN 19 1999

SECTION

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Iron (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>35W</u>	<u>1-6</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

IRON COUNTY
MICHIGAN
RECEIVED FOR RECORD
98 DEC 28 AM 11:28
L.C. Records: L. 333
Gary L. Pisoni
REGISTER OF DEEDS
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Quarter Corner Sections 14 and 15, T43N, R35W

I, Gary L. Pisoni, in a field survey on December 16, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15	●	14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established in August, 1851 by Harvey Mellen, Deputy Surveyor.
Original Corner; Wood Post
Original Bearing Trees:
Spruce 6" N 24° E 16 lks (10.56 feet)
Spruce 10" S 24° W 6 lks (3.96 feet)

PEER GROUP APPROVED
Iron A. Pisoni 12-18-98
COUNTY REPRESENTATIVE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.
In 1980, found an iron pin located in the centerline of a North/South county road marking the quarter corner position, said pin was set by W.E. Dewald, a mining engineer, in the early 1950's. W.E. Dewald also set a drill rod 33' West of the quarter corner. In early 1990's, the iron pin was destroyed during the rebuilding of the county road. I reset the quarter corner position with a P.K. nail.
P.K. nail is located in the centerline of the county road. I accept the corner position as the best available evidence for restoring the corner position.
Distance along Section line is consistent with GLO distance.


Corner record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
From the above described corner position, I set two reference monuments, being a 5/8" diameter by 30" long rebar, with a 3" aluminum cap stamped as follows: Iron County Remonumentation, T43N, R35W, R.M., 1/4, S-14, S-15, S 41° W, 49.22', 1998, RLS 2745; T43N, R35W, R.M., 1/4, S-14, S-15, N 20° W, 70.99', 1998, RLS 27457 from which the following reference objects bear:

R.M.	5/8" x 30" rebar	N 41° E	49.22 feet
Utility Pole	#74-1163	S 56 E	30.42 feet
R.M.	5/8" x 30" rebar	S 20° E	70.99 feet
Drill rod set by W.E. Dewald	West		33.03 feet
Steel sign post		N 41° E	49.95 feet

98-161
Signed by Gary L. Pisoni Date 12-21-98
Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS JAN 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

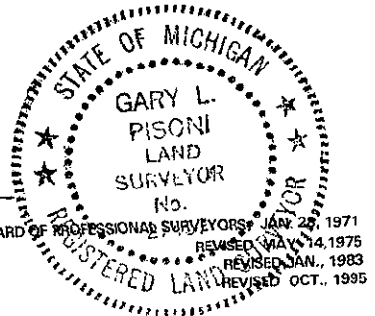

L. 7 P. 333