

52.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Area	Located In:	Corner Code #
1. Public Land Survey	T 44N R 31W	K3
	T 44N R 31W	K6
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

K6 Jun 23 1997
K3 Jun 18 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3											●		
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13					●		
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:
(K3) Corner common to Sections 1-2-11-12. Corner established in 1849 by John Burt: "North between Secs. 11 & 12...80.00 N. Pine 30 inches in diameter". Mr. Robert Perkins, PS, Iron Mountain, told me that he found a 3/4" iron bar at this location and accepted it as marking the corner in the late 1970's. Evert Muller, PS, told me that in May, 1954, he found a 3" squared post at this location which was 4' south of a 30" dia. pine stub.
(K6) Quarter corner common to Sections 13-14. Corner established in 1849 by John Burt: "Set cedar Gr. Section Post Sugar 16 N75W 26, Fir 12 S43E 19". Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(K3) Found a 3/4" dia. reinforcing rod located in the stump remains of a N. Pine of undetermined size. Part of the bole of the tree has fallen over to the west and it shows evidence of old blazes or ax marks. Could not determine if this was the original corner tree or not. Several old blazes face this location. Measured distances North, East and South to monumented corners as follows: 5326.7' N (80.39 ch. R), 5342.2' E (80.22 ch. R), and 2637.7' S (40.00 ch. R). Found no evidence of the 1954 post. I accepted the monument as being the best available evidence of the position of the original corner. Left the monument in place and made new witnesses as described below.

(K6) Original post and accessories not recovered. Found no evidence of the position of the original corner on the ground. Reestablished the corner midway and on a straight line between section corners 2627.9 ft. North and South. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MNR tablet, appropriately stamped. Corner placed and witnessed by S. Wheeler, and D. Laapala, Beraga District Office, MNR.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K3) Found 3/4" rebar
Blazed and scribed the following new bearing trees:
15" N. Pine N46E 8.4' "S1 NBT"
9" N. Pine S16W 26.5' "S11 NBT"
The following dist. are to nails set by others:
20" N. Pine N43W 6.5' "S2 NBT"
15" Spruce S42E 6.2' "S12 NBT"
Squared a 2" Balsam S70W 3.1'. Bearings are magnetic.

(K6) Set 1" pipe with 4" MNR cap.
Blazed and scribed the following:
10" Triple Maple N89E 14.6' "1/4S NBT"
8" Maple S32E 28.3' "1/4S NBT"
6" Double Maple S37W 17.5' "1/4S NBT"
8" Maple N35W 3.0' "1/4S NBT"
Placed a squared spruce post adjacent.
Bearings are magnetic.

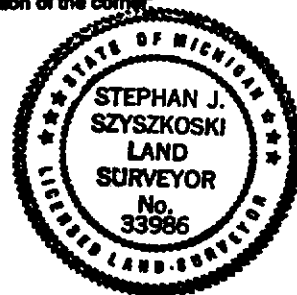

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date Sept. 8, 1997

For the Michigan Department of Natural Resources - Forest Management Division