LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Iron	Located In:	Corner Code #
(County)		
1. Public Land Survey	´ T <u>44N</u> R TR TR	31W 13
2. Property Controlling in Section	S TR	

Register of Deeds Stamp & File Number


4. Lot No	, Recorded Plat
5. Private Claims	

3. Miscellaneous Property in Sec.

Sep 22 1997

Stephan J. Szyszkoski , in a field survey on . 19 _ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current menual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

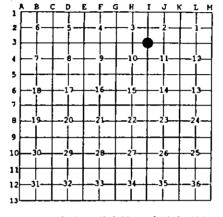

A. Description of original monument and accessories and/or subsequent restoration:

(I3) Corner common to Sections 2-3-10-11. Corner established in 1849 by John Burt: "Set cedar post, Hemlock 14 S70E 22, Hemlock 8 N66M 17". Between 2 and 11, "Mest true line, ...1) 19.00 Enter swamp C SM, 2) 21.80 Brook 10 L C SM, ...3) 40.01 Set qr. Sec. Post...4) 40.50 Leave swamp C SM...5) 45.00 Top of ridge 20 feet C SM... 6) 68.50 Leave swamp M&S...7) 80.03 Section corner. Between 3 and 10, "Mest corrected 8) 2.00 Stream 100 t C S. quick". Original distances between corners: 9) F3-I3 7936.5' R, 10) I8-I3 13200' R, 11) J3-I3 2641' R. 12) I1-I3 5269' R.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(I3) Original post and accessories not recovered. Reestablished the corner in accord with the record as referenced above: calls 1) -6) check. 7) 79.88 ch. Meas, 8) checks, 9) 7920.2' Meas, 10) 13191.08' Meas, 11) 2636.3' Meas, 12) 5265.4' Meas. I note that the above record calls along the line between Sections 2-11 would not fit should the corner be north or south of this position. In addtion, the distances from the reestablished position are in proper proportion to the original distances between the corners noted above. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDMR tablet, appropriately stamped. From the position monumented, I found an angle iron and adjacent MEAD Corp. location poster facing it, N42M 37' distant. This iron seems to mark an approximate corner, as it does not fit the record. Corner placed and witnessed by O.Lampela and B. Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(13) Set 1" pipe with 4" MDNR cap Blazed and scribed the following: 11 Spruce N69E 23.4 S2 H81 "SIO NOT" 12" N. Pine \$26W 25.0" B" Cedar \$48N 20.2" "SIO NBT" 12" Spruce \$29E 3.3" "SII NBT" Placed a squared cedar post adjacent. Bearing are magnetic.

STEPHAN J SZYSZKOSKI LAND SURVEYOR

38986 Surveyor's Michigan License No

Date

For the Michigan Department of Natural Resources - Forest Management Division