

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

(IRON COUNTY)

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> ^{N.} XX , R. <u>34</u> ^{XX} W.	L-11 & M-11
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____, S., R. _____, E., W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____, S., R. _____, E., W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner L11 (1/4 corner between Sections 25 & 36, T44N, R34W):

Wood post (Not found. Found 1 1/2" round iron pin in place.)
 Sugar 12 S15E 105 (" " No subsequent accessories found.)
 Fir 9 N25W 82 (" " " " " ")

Corner M11 (Section Corner 25, 30, 31, & 36, T44N, R33-34W):

Ironwood post (Not found. Found 2 wood posts in place.)
 Sugar 16 N82E 30 (" " No subsequent accessories found.)
 Fir 10 S68W 13 (" " " " " ")
 Sugar 10 N14W 32 (" " " " " ")
 Sugar 16 S14E 13 (" " " " " ")

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner L11: On 8/4/77, witnessed iron pin as found. Who set and why here not known, but pin bears N89°47.1'E 40.363 ch. from sec. cor. to W and S89°45.2'W 40.217 ch. from sec. cor. to E indicating it may have been intended to have been set proportionately on line. The alinement is fair, but the proportion not too good; however it did not seem advisable to alter it on that account.

Corner M11: On 8/23/76 replaced wood post #1 (an older 2"x2"x2' squared cedar post) and wood post #2 (a newer 3"x3"x5' squared cedar post) with monument described below. Corner bears N0°07.0'E 79.517 ch. from twp. cor. to S and S0°11.8'E 80.079 ch. to N, but as I cannot demonstrate that the original corner placement was any more accurate than this, I accepted it as found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner L11: 1 1/2" round iron pin of unknown length (same monument as found.)
 W. Spruce 16 S 4°E (mag.) 71.2 ft. "1/4S, NBT"
 Elm 12 N42°E (mag.) 62.2 ft. "1/4S, NBT"

Corner M11: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 Sugar Maple 8 S80°W (mag.) 20.8 ft. "S36, NBT"
 Cedar 16 S82°E (mag.) 62.7 ft. "S31, NBT"

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____


(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE October 25, 1977

CHIEF OF SURVEY PART
 MICHIGAN REGISTERED LAND SURVEYOR

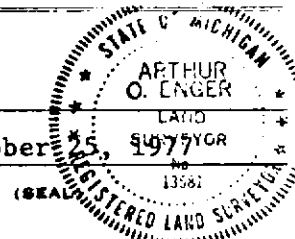

Arthur O. Enger
 Michigan Department of Natural Resources
 SURVEYOR'S MICHIGAN REGISTRATION NO. 13581