

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

(IRON COUNTY)

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> ^{N.} XX , R. <u>34</u> ^{XX} W.	C-13
2. PROPERTY CONTROLLING IN SECTION _____	T. _____, S., R. _____, E. _____, W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____, S., R. _____, E. _____, W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 29, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner C13 (Section Corner 5, 6, 31, & 32, T43-44N, R34W):

Maple post	(Not found. No subsequent monuments found.)	
Hemlock 30 N65E 15	(" " " " " ")	
Y. Birch 6 N43W 16	(" " " " accessories ")	
Y. Birch 6 S37W 29	(" " " " " ")	
Sugar 12 S28E 32	(" " " " " ")	

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner C13: Found a 1" drill rod of unknown length 33 feet E of the intersection of approx. CL's of county roads running N & S and W. The rod aligns with a fence going E and one going N parallel to the N-S road. Based on measurements to corners 3 miles N and 1 mile E, and the estimated position of the twp. corner 1 mile W, the drill rod appears to be a witness corner for the true corner, which, in my opinion, lies in the roadway at the intersection of road centerlines, 33.0 ft. West of the drill rod. A search was made in that area, excavating to undisturbed ground under the roadbed, but no other monuments were discovered. There are unharmonious elements involved, in the directions and distances to this point from other points, this point being in particular harmony with an original corner 3 miles N, which harmony would be disturbed if the corner position were harmonized with corners to the E & W. I am inclined to accept the road corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

} centerline intersection as being the corner by common report

Corner C13: 1" drill rod of unknown length, for Witness Corner.
 UPPCo. Power Pole #101 N6°W (mag.) 23.68 ft.
 Sugar Maple 10 S64°E (mag.) 11.48 ft.

Note: Witnesses are for the drill rod and not for the probable true corner.
 Distances are to a nail with 3/4" brass washer stamped "WITNESS MARK."


SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE May 5, 1978
CHIEF OF SURVEY PARTY
MICHIGAN REGISTERED LAND SURVEYOR

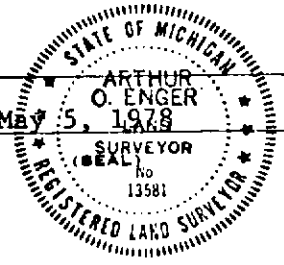

Arthur O. Enger
 Michigan Department of Natural Resources
 SURVEYOR'S MICHIGAN REGISTRATION NO. 13581

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET