

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>44</u> N. <u>34</u> R. <u>34</u> <u>W.</u>	<u>G9 &amp; H9</u>
2. PROPERTY CONTROLLING IN SECTION_____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION_____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

**Corner G9 (Section Corner 21, 22, 27, & 28, T44N, R34W):**  
 Wood post (Not found. No subsequent monuments found.)  
 Y. Birch 10 N55W 29 (" " " " accessories " )  
 Sugar 16 S70E 9 ( Found?? " " " " )  
**Corner H9 (1/4 corner between Section 22 & 27, T44N, R34W):**  
 Wood post (Not found. See B for subsequent monument.)  
 Sugar 14 S40W 15 (" " . No subsequent accessories found.)  
 Lynn 16 N20E 10 (" " " " " " )

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

**Corner G9:** Re-established 5/26/77 at computed record latitude of a line N0°45.2'W 79.8724 from Sec. Cor. 27, 28, 33, & 34 (original) with a line whose departure is the record distance E of an original 1/4 cor. 200.011 ch. W. By coincidence or otherwise, the corner falls at a position from which a rotted sugar maple stump, bearing a trace of scar tissue overgrowth on the NW side, is situated S70°E 9 lks., which exactly matches one of the original BT's.  
**Corner H9:** Re-established 6/24/77 on line between Sec. Cor. 39.858 ch. to E and to W. Found a 2"x2"x5' squared cedar post S82°33'E 82.4 ft. for an approx.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**Corner G9:** 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap  
 Sugar Maple 9 S59°E (mag.) 45.0 ft. "S27, NBT"  
 Sugar Maple 8 N78°W (mag.) 47.3 ft. "S21, NBT"  
 Declination 0°00'  
**Corner H9:** 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap  
 Sugar Maple 6 N80°W (mag.) 25.5 ft. "1/4S, NBT"  
 Hemlock 16 N58°E (mag.) 17.2 ft. "1/4S, NBT"  
 Declination 0°00'

SIGNED BY \_\_\_\_\_ DATE July 28, 1977


SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Arthur O. Enger DATE July 28, 1977  
CHIEF OF SURVEY PARTY  
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger  
 Michigan Department of Natural Resources  
 13581

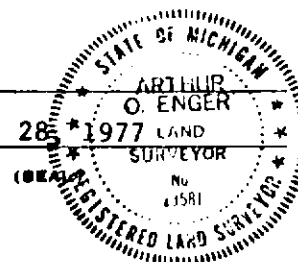

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_