

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. R. <u>34</u> W.	B9 & C9
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner B9 (1/4 corner between Sections 19 & 30, T44N, R34W):

Wood post (Possibly found. See B for other monuments.)
 Tamarack 20 S61E 17 (Probably found. No subsequent accessories found.)
 Cedar 8 N41W 18 (Not found. No subsequent accessories found.)

Corner C9 (Section Corner 19, 20, 29, & 30, T44N, R34W):

Wood post (Not found. No subsequent monuments found.)
 Y. Birch 30 S26W 42 (Not found. No subsequent accessories found.)
 Sugar 18 N53E 24 (Not found. No subsequent accessories found.)

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner B9: Re-monumented 5/20/77 at site of 4 wood post points of varying ages, the oldest possibly being the point of the original post. From the posts, a rotted tamarack stump about 20 inches in diameter lies at the record bearing and distance; is presumed, therefore, to be the original BT. Corner in swamp.

Corner C9: Re-established 5/26/77 by proportionate measurement between corners 2 miles S and 1 mile N, and at record distance from original corner 1/2 mile W. Corner thus set falls in approx. centerline of N & S county road and on S edge of E & W roads.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner B9: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap
 Cedar 18 N67°W (mag.) 55.6 ft. "1/4S, NBT"
 Cedar 16 S25°E (mag.) 50.3 ft. "1/4S, NBT"

Corner C9: 1" I.D. x 24" iron pipe with 3 3/4" aluminum cap
 Sugar Maple 9 S49°W (mag.) 47.7 ft. "S30, NBT"
 Nail with 3/4" brass washer stamped "WITNESS MARK" in
 Power Pole N28°W (mag.) 42.59 ft.
 Top of monument is about 8" below road surface.

SIGNED BY _____ DATE July 28, 1977

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE July 28, 1977

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
 Michigan Department of Natural Resources

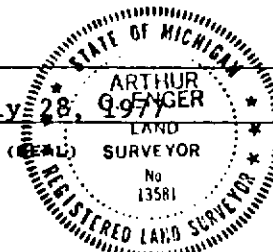

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581