


LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Iron	Located In:	Corner Code #
(County)		
1. Public Land Survey	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S 24 T 44N R 34W	1
	S 24 T 44N R 34W	4
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

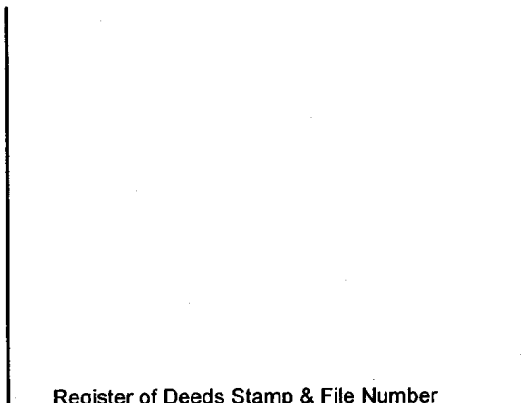

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, Stephan J. Szyszkoski, in a field survey on 05/14/2008 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- (1-Sec. 24) West 1/16 corner between Sections 13 and 24. 1977 - Established by A.O.Enger RLS midway and on the Section line between Section corner 20.014 chains west and Quarter corner 20.014 chains east. Set chiselled "+" in rock ledge at the corner position. Cedar 6" N44E 4.1', Spruce 6" S79E 4.1'.
 - (4-Sec. 24) Northwest 1/16 corner, Section 24. Not established in the original survey.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- (1-Sec. 24) Recovered the corner mark of record, as described, at record bearing and distance from the Cedar BT NE, in good condition with scribing visible. Found the corner position to be substantially at the record position and accepted same as a careful and faithful establishment of the position of the corner.
 - (4-Sec. 24) Established the corner at the intersection of straight lines connecting opposite 1/16 corners.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- | | |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <ul style="list-style-type: none"> (1) Fd. "+" chiselled on rock ledge. Set measuring nail with MDNR tag in the side of:
 7" Cedar N47E 4.25' scribing vis. (1977 BT)
 6" Sugar S12W 18.1' mrkd "1/16S BT"
 6" W.Birch S52W 8.8' do
 3" Y.Birch N42W 8.2' mrkd " X X "
 Sq'd post adjacent. Bearings magnetic. | <ul style="list-style-type: none"> (4) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Set measuring nail with MDNR tag in the side of:
 5" Balsam N09E 55.4' mrkd "1/16S BT"
 5" Sugar N78E 28.5' do
 7" Balsam S42W 10.05' do
 7" Spruce N74W 14.0' do
 Sq'd post adjacent. Bearings are magnetic. |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 05/22/2008

For the Michigan Department of Natural Resources, Office of Land and Facilities

