## LAND CORNER RECORDATION CERTIFICATE Mich. P.A. 1970


For comers in	Filing Requirement of Act 74	
	Located In:	Corner Code #
(County)	Located in:	Corner Code #
1. Public Land Survey	Ť <u>468</u> R T <u>468</u> R TR	34W J9
Property Controlling in Section	TR S TR S TR	
3. Miscellaneous Property in Sec.	S TR S TR	
4. Lot No, Recon	ded Plat	

Register of Deeds Stamp & File Number

J9 Aug 05 1998 19 Jul 23 1998

L Stephan J. Szyszkoski \_, in a field survey on do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformence with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

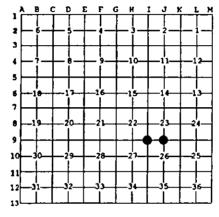

Description of original monument and accessories and/or subsequent restoration:

(19) Corner common to Sections 22-23-26-27. Corner established in 1852 by Zelotes B. Searles: "M3'E corrected...80.24 Set post Cor. of Secs. 22,23,26 & 27. Spruce 12 S80M 7, Cedar 10 M59E 30." Found no subsequent record.

(J9) Quarter corner common to Sections 23-26. Corner established in 1852 by Zelotes 8. Searles: "...40.18 Set quarter Section post. Tam 6 5658 7, do 6 N77M 47. December, 1953 Morthern Paper Hills record at Ned Lake Timber and Land Co. states 1930: Cole and Sillers Found 8' Tam stub NW I.M plain. 1953: Mickman and Peryam found post Tam. stump M.W. staked 8.T. Set pipe at post from B.T. Description of corner monument: Iron pipe and brass cap. Witnesses to corner: W. Pine 14 S78E 101 links".

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(I9) Driginal post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner by double proportionate measurement to the original record between original corners 40,0649 ch. north (40.12R), 40.2194 ch. east (40.18R), 80.1291 ch. south (80.24R), and 80.0402 ch. west (79.96R). At the position for the corner I placed a 1"IOx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Found numerous younger trees with blazes in the immediate corner area. Corner placed and mitnessed by D.Lampela and S.Wheeler, Baraga District Office.

(J9) Recovered the 1953 monument as described, a 1° ID iron pipe capped with a 2° brass tablet stamped "MORIHERN PAPER HILLS", in good condition, and at record bearing and distance from the 1953 M. Pine BT, in good condition with scribing visible in BH and lower blazes. The old post was also recovered upright and adjacent. Accepted the monument as a careful and faithful perpetuation of the position of the original corner. Left the monument in place and marked three new mitnesses as described below. Corner recovered and remitnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for c (19) Set 1 pipe with 4" MONR cap. Description of monument for corner and accessories established to perpetuate locating the position of the corner (J9) Found 1" pipe with 2" brass cap.

are magnetic.

Blazed and scribed the following: 22 W. Pine S10W 38.55' "527 NBT" 7° Y. Birch NS7W 14.25' "\$22 MBT" 7" Cedar N47E 10.35" "S23 NBT" 8° double Cedar S40E 33.0° "S26 NBT" Distances are to meas, notch, Bearings

are magnetic. A squared 4" spruce is

\$20£ 2.0' to center of tree.

Blazed and scribed the following: "1/45 NBT" 8" Cedar N85E 65.7" 7° W. Pine S48W 22.0 do

5" Tamarack N48W 15.2 The 1953 witness: 18" W. Pine S71E 66.3' with fd marks Placed a squared cedar post adjacent. Distances are to meas, notch. Bearings SE OF MIC STEPHAN J SZYSZKOSKI LAND SURVEYOR 33986

Surveyor's Michigan License No

For the Michigan Department of Matural Resources - Forest Management Division