

CORNER COMMON TO SECTIONS 25, 26, 35, & 36
SUMMIT TOWNSHIP

SURVEY & REMONUMENTATION

MAR 13 2000

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in Jackson Located In: _____ Corner Code # _____
(County)

- 1. Public Land Survey T 3 S R 1 W
T _____ R _____
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Section S _____ T _____ R _____

K-11



2139380
Page: 1 of 2
12/08/1999 11:41A
L-1818 P-1234

Mindy Reilly - Jackson Co. CORREM

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

Timothy B. VanGieson, in a field survey on October 31, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- K-11: Original government survey dated February 12, 1825. "Set post corner sections 25, 26, 35, and 36."
"Wood Post"
Yellow Oak 10" N 70° E 17 lks. (11.22')
Yellow Oak 18" S 28° W 59 lks. (38.94')
Hervey Parke (Deputy Surveyor)
May 04, 1825
- K-11: Remonumentation survey dated 1886
"Fire Clay"
Yellow Oak 16" N 85-1/2° E 51 lks. (33.66')
Maple 1" N 36° E 67 lks. (44.22')
"Post out. Found remains of witnesses."
H.F. Bean 1886
- K-11: See back for additional supporting documentation.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- K-11: Found 3/4" pipe in monument box. Excavated at this location and found two broken pieces of fire clay (stacked on top of one another) at a depth of 1.5' below existing road surface. Found large pieces of crockery around the top of the fire clay and a 3/4" x 14" pipe on the East side of fire clay. Found 36"± stump (remains of second 1886 accessory) N 80°±E 34.30'

Accepted fire clay as faithful and careful perpetuation of Corner K-11.

Set standard Jackson County Remonumentation "Harrison" monument in place of fire clay. Left top 1.1' of fire clay on West side of monument. Left bottom 0.9' of fire clay on East side of monument. Left found 3/4" pipes on North and South side of monument.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- L-11: 4" x 30" Harrison Monument with brass cap R.L.S. 24621
N 15° E 60-d in West side 23" Oak 192.17'
N 90° E Sign post 33.0'±
S 80° W 60-d in North side power pole 135.03'
N 83° W 60-d in South side 50" Oak 38.45'
N 82° W 60-d in South side 30" Oak 42.25'
N 22° W 60-d in East side 28" Oak 67.02'
N 02° W 60-d in East side 38" Oak 139.86'

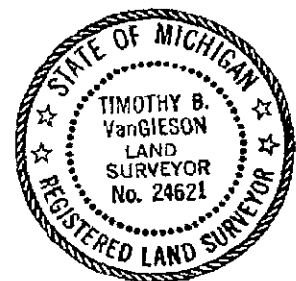

Signed by Timothy B. VanGieson

Date November 22, 1999

Surveyor's Michigan License No. 24621

A (continued)

Source: Richard E. Gutekunst Registered Land Surveyor No.7863

Date: August 16, 1974

"Found fireclay with crockery around - 1.1 below blacktop surface. Set 13" capped iron on top of fireclay to surface; also set iron on east side flush with top of fireclay."

N 85-1/2° E	Yellow Oak 30"	34.59'
West	Oak 36"	38.07'
S 10° W	Walnut 14"	187.71'
N 10° E	Oak 11"	192.29'

1'± West of center of pavement
17'± North of white pickett fence

Source: P.A. 74 recorded in Liber 2 Page 629 by Douglas W. Hooth Registered Land Surveyor No.7966

Date: June 03, 1977

Item B of Liber 2 Page 629

"Found 1/2" Iron Pipe with RLS Tag #7863 (R. Gutekunst) Draper Rd. N & S"

N 85° E	30" Y. Oak	34.59'
West	36" Oak	38.07'

Item C of Liber 2 Page 629

"Installed Mon. Box 4-06-77 (Found Stone and Crockery)"

N-85-E	34.12'	36" Oak
N-55-E	36.34'	Wood Gate Post
West	38.14'	38" Oak

**SURVEY &
REMONUMENTATION**

MAR 13 2000

SECTION



Mindy Reilly - Jackson Co.

CORREM

2139380

Page: 2 of 2

12/08/1999 11:41A

L-1618 P-1234