

**JACKSON COUNTY
APPROVED LAND CORNER**

P.A. 345 of 1990
Acting Chairman Dean R. Gutekunst
 Date Aug 12, 1998

SOUTHEAST CORNER, SECTION 32
 NAPOLEON/NORVELL TOWNSHIP

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

**SURVEY &
REMONUMENTATION**

JAN 27 1999

For corners in
JACKSON

(County)	Located In:	Corner Code #
1. Public Land Survey	T <u>3 S</u> R <u>2 E</u>	<u>E-13</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____


SECTION



2085843
 Page: 1 of
 08/31/1998 12
 L-1578 P-8

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, DEAN R. GUTEKUNST, in a field survey on September 24 & 25, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

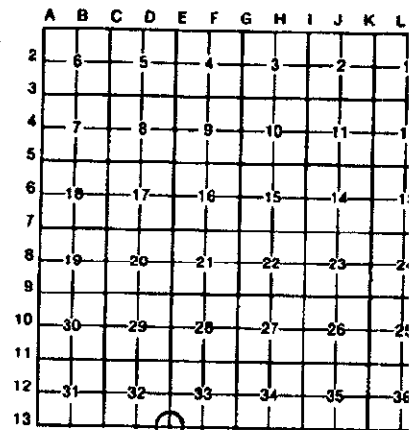

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original Government Post set by Hervey Parke, Deputy Surveyor, 1824.
 B. Ash 24" N 68 E 17 links (11.22')
 Lynn 24" N 66 W 19 links (12.54')
 Perpetuation, no name, no date.
 Elm 5" N 26 W 32 1/2 links (21.285')
 Maple 18" S 18 E 118 1/4 links (78.045')

Found Fireclay post set for Norvell

Continued on back,

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" rod at surface of blacktop.
 Found bottom 12" of Fireclay, 2.5' below surface, under rod.
 Corner is 2'± South of the center line of Sharon Valley Road (blacktop). There is no occupation to the North, at the road.
 Accepted Fireclay as a careful and faithful perpetuation of the position of the original corner.
 Set a Standard Jackson County Monument on top of the Fireclay and left rod buried on the South side of the monument.



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-13 T3S, R2E Corner is a 4" diameter X 30" Cast Iron Harrison monument with a Brass cap stamped LS 18658, which is a standard monument for Jackson County.
 S 70 E 8" Maple 78.54' Pole barn spike and washer on North side.
 N 80 W 33" Oak 135.25' Pole barn spike and washer on South side.
 N 60 E 8" Maple 70.18' Pole barn spike and washer on South side.
 S 10 W Clump of Maples (6"-9" & 17") 48.94' Pole barn spike and washer on West side
 S 70 W 7" Red Maple 113.50' No nail, center of tree.
 East Northeast corner of Section 5, T4S, R2E 227.95' (346 links - 228.36')
 North Steel post and survey marker sign attached 25'
 Monument box set over monument by Jackson County Road Commission.

Signed by Dean R. Gutekunst Date August 1, 1998
 Surveyor's Michigan License No. 18658

SURVEY &
REMONUMENTATION

E-13 T3S, R2E

JAN 27 1999

Continued,

SECTION

- A.) - Perpetuation by H. F. Bean, no date.
Beech 14" S 19 W 77 $\frac{1}{2}$ links (51.15') No description
Willow 10" N 76 $\frac{1}{2}$ E 93 links (61.38')
- Perpetuation by LaRue, no date.
Elm 5" N 26 W 32 $\frac{1}{4}$ links (21.285') Found old corner.
Elm 10" S 73 $\frac{1}{2}$ E 113 $\frac{1}{2}$ links (74.91')
- Not recorded in P.A. - 74.



Mindy Reilly - Jackson Co.

CORREN

2085843

Page: 2 of 2

08/31/1998 12:50P

L-1579 P-888