

Acting Chairman R. Enger Ren Enger

LAND CORNER RECORDATION CERTIFICATE

Date 12-30-94

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

JACKSON

(County)

Located In:

Corner Code #

- | | | | | | | | |
|------------------------------------|---|---|---|---|---|---|------|
| 1. Public Land Survey | T | 4 | S | R | 1 | E | G-13 |
| | T | | R | | | | |
| | T | | R | | | | |
| | T | | R | | | | |
| 2. Property Controlling in Section | S | | T | | R | | |
| | S | | T | | R | | |
| 3. Miscellaneous Property in Sec. | S | | T | | R | | |
| | S | | T | | R | | |

STATE OF MICHIGAN
JACKSON COUNTY
RECORDED

17 AUG 95 9:59 A.M.

GERALD J. McDEVITT
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, DEAN R. GUTEKUNST, in a field survey on August 2, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:

Original Government Post set by Benjamin Hough, Deputy Surveyor, 1815
 B. Oak 12" S 74 E 56 links (36.96')
 B. Oak 10" S 48 W 59½ links (39.27')
 Perpetuation by M. S. Cook, date unknown
 B. Oak 6" N 34 W 41 links (27.06')

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found pointed SANDSTONE, 1.4' below surface, on center line of blacktop.
 Found railroad spike at surface of blacktop, 0.4' West and 0.8' North of sandstone. This spike would appear to fit the plat of Southern Shores at Lake Columbia.
 Also found railroad spike 1.6' East and 0.8' North, of sandstone.
 Backhoe excavation, starting at point of railroad spikes, was approximately 4' wide by 6' long by 4' deep.

Accepted SANDSTONE as a careful and faithful perpetuation of the position of original corner.
 Replaced sandstone with a Standard Jackson County Monument and left sandstone buried below monument.

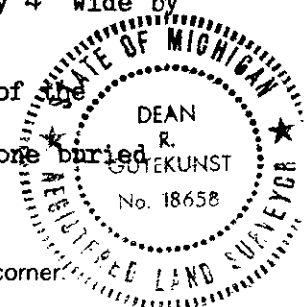

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-13 T4S, R1E Corner is a 4" diameter X 36" concrete monument with a ½" X 36" steel rod and an aluminum cap stamped LS 18658, which is the standard monument for Jackson County.

N 45° W	Southwest corner of foundation of House # 16002	109.30'	Monument
N 35° E	Southeast corner of foundation of House # 16000	85.45'	box set
N 60° E	Utility pole 77.42'	60d & washer on South side	over monu.
S 80° W	18" Walnut 116.24'	Double head nail and washer on North side	by
N 10° W	Southwest corner of foundation of garage	66.70'	JCRC.
West	Found iron for Northwest corner of Section 3, Woodstock Township, Lenawee County	86.20' (Government jog 130 links - 85.80')	
South	Steel post with survey marker sign attached	27.5±	

Signed by Dean R. Gutekunst Date December 29, 1994

Surveyor's Michigan License No. 18658