

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

MAR 01 2000

For corners in

KALKASKA
(County)

Located In:

Corner Code #

SECTION

1999 REMONUMENTATION
1. Public Land Survey

T 25N R 7W

C-8

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R



3020153

Page: 1 of 1

02/04/2000 03:40P

REMON
LB: 6 PG: 99

Kalkaska County Joan Hall, Register

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, EUGENE FARRIER, in a field survey on November 2, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

C-8: 1/4 Cor. Common to Sec. 19 & 20, T25N-R7W, Garfield Township

1853, G.L.O. Resurvey, by V.W. Caukin (Deputy Surveyor) Co. Survey Notes Pg. 66, set 1/4 post, Birch 8", N21.75°E, 30 Lks (19.8'); Birch 8", S29°W, 29 Lks (19.14')

1973, LCRC & Survey, by J.F. Erickson, (LCRC recorded in Liber 1, Pg. 200; Survey recorded in Liber 1, Pg. 285), set 1/2" rod M.P.O.L., fell in East wheel track of trail road, N90°W, 67.00', 10" Maple; N45°E, 55.67', 6" Spruce; S55°E, 40.05', 13" Twin Maple.

1991, Survey, by E. Farrier (Co. Surveyor), found 1/2" iron RLS #14102, same witnesses as Erickson LCRC (1973)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-8: 1/4 Cor. Common to Sec. 19 & 20, T25N-R7W, Garfield Township

Found and accepted 1/2" X 24" rerod 2' East of centerline of N-S road.

S80°W, 14.66', 6" Maple, set nail & washer

N77°W, 22.88', 8" Cedar, set nail & washer

N57°W, 22.56', 6" Elm, set nail & washer


East 33.00', iron & cap #24594

No G.L.O. witnesses were found.

Ratified by Peer Group
P.A. 345 - 1990 Kalkaska County

Chairman Eugene Farrier

Date 02-03-00

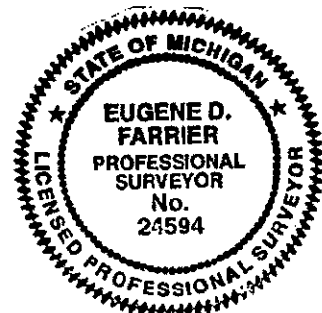

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-8: 1/4 Cor. Common to Sec. 19 & 20, T25N-R7W, Garfield Township

Found and accepted 1/2" X 24" rerod 2' East of centerline of N-S road. Pulled & replaced with 5/8" X 18" rerod w/brass cap

S80°W, 14.66', 6" Maple, set nail & washer

N77°W, 22.88', 8" Cedar, set nail & washer

N57°W, 22.56', 6" Elm, set nail & washer

East 33.00', iron & cap #24594

Kalkaska County Peer Group accepted the above monument as a careful and faithful reestablishment of the position of the original corner.

Signed by Eugene Farrier
Michigan License No. 24594

Date 02-04-00 Surveyor's