

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SURVEY &
RECORDATION

MAR 11 2000

For corners in

KALKASKA Located In: Corner Code #
(County)
1999 REMONUMENTATION
1. Public Land Survey T 25N R 7W F-7
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

SECTION



3020164
Page: 1 of 1
02/04/2000 03:40P
REMON
LB: 5 PG: 110

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, EUGENE FARRIER, in a field survey on November 5, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


A. Description of original monument and accessories and/or subsequent restoration:

F-7: 1/4 Cor. Common to Sec. 16 & 21, T25N-R7W, Garfield Township
1853, G.L.O. Resurvey, by V. W. Caukin (Deputy Surveyor) Co. Survey Notes Pg 21, set quarter Sec. post, Beech 22", S24°W, 28 Lks; Beech 12" N85°W, 36 Lks
1905, Survey, by W. S. Merrill (Co. Surveyor) Co. Survey Bk 22, Pgs. 44-46, Hemlock 14", N15°E, 63 Lks
1912, Fargo Survey, no U.S. evidence found, set 3/4" pipe, Sugar 14", S8.5°E, 1.29 1/4 Ch.; Sugar 16", S22°W, 1.64 1/2 Ch.
1973, Survey, J.F. Erickson, no accessories
1980, Survey, by E. Farrier (Co. Surveyor), found 3/4" pipe, S35°W, 16" W. Pine, 19.03'; S11°E, 8" Ash, 33.83'; S50°E, 7" Maple, 26.55'; N31°W, 4" Ironwood, 15.47'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F-7: 1/4 Cor. Common to Sec. 16 & 21, T25N-R7W, Garfield Township
Found 3/4" X 24" iron pipe.
N31°W, 15.48', 6" Ironwood, found spike
N65°E, 8.43', 5" Poplar, set nail & washer
S43°E, 31.69', 12" Twin Maple, set nail & washer
S35°W, 19.05', 18" W. Pine, found spike
No G.L.O. witnesses were found.

Ratified by Peer Group
P.A. 345 - 1990 Kalkaska County
Chairman Eugene Farrier
Date 02-03-00

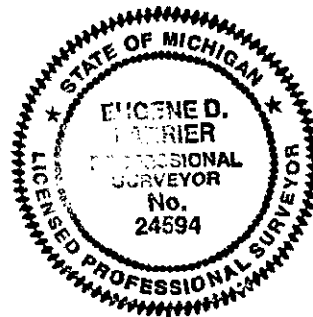

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-7: 1/4 Cor. Common to Sec. 16 & 21, T25N-R7W, Garfield Township
Found 3/4" X 24" iron pipe. Pulled and set 5/8" X 36" rerod w/ aluminum cap.
N31°W, 15.48', 6" Ironwood, found spike
N65°E, 8.43', 5" Poplar, set nail & washer
S43°E, 31.69', 12" Twin Maple, set nail & washer
S35°W, 19.05', 18" W. Pine, found spike
Kalkaska County Peer Group accepted the above monument as a careful and faithful reestablishment of the position of the original corner.

Signed by Eugene Farrier
Michigan License No. 24594

Date 02-04-00 Surveyor's