

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>28</u> ^{N.} <u>●</u> R. <u>7</u> ^{W.} <u>●</u>	<u>K-12; K-13; L-13</u>
2. PROPERTY CONTROLLING IN SECTION <u>36</u>	, T. <u>28</u> ^{N.} <u>●</u> R. <u>7</u> ^{W.} <u>●</u>	<u>15</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ ^{N.} _____ ^{S.} R. _____ ^{E.} _____ ^{W.} _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 30, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A - Description of original monument and accessories and for subsequent restoration:~~

C. (continued)

- | |
|---|
| 15 |
| Set 3/4"x40" rerod & cedar post w/loc. tag |
| 9" Maple S73°W 25.5 |
| 8" Maple S22°W 62.7 |
| 7" Twn. Maple S55°E 23.5 |
| Ctr. E-W dirt road Due N 20'± |

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- K-12 Fd. stake hole shadow & two pieces of cast iron, buried in N-S dirt road. Fits Merrill distance S one-half mile dated June 1920.
- K-13 Found 1/2" rerod by RLS Verba in approximate center of N-S dirt road. Dirt road to W is 17'± South.
- L-13 Reestablished 1/4 corner S.P. Corner falls in southerly wheel track of old E-W grade in swp.
- 15 Established 1/16 corner per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-12	K-13	L-13
Drove 1 1/4"x20" Rod.	Fd. rerod & set 1 1/4"x18" iron rod,	Drove 1 1/4"x40" pipe (old black pipe)
8" B.Cherry S62°W 43.4	36" Maple N37°E 73.00	10" Cedar S53°E 117.8
12" Twn. B.Cherry S64°E 37.5	P. Pole N65°E 42.71	5" Cedar S14°E 23.0
24" Maple S38°E 100.7	6" W. Pine S58°E 108.08	5" Cedar S24°W 44.0
10" B.Cherry N52°W 68.2	10" B.Cherry S55°W 62.70	5" Cedar S41°W 72.3
Set cedar post w/loc. tag	Set cedar post w/loc. tag	6" Cedar S41°W 72.3
Due E 33'	N45°E 47.7	Set cedar post w/loc. tag
Ctr. N-S dirt road Due E 3'±		Due N 16.5'

SIGNED BY Carl F. Roser

DATE 10-31-77

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ CHIEF OF SURVEY PARTY

DATE _____

APPROVED AND SIGNED BY _____ MICHIGAN REGISTERED LAND SURVEYOR

DATE _____

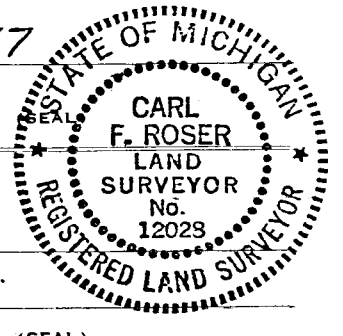

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

RAPID RIVER TOWNSHIP
KALKASKA COUNTY