MAY 28 1997

For corners in Texas Twp.

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

2PAGE 097 LIBER


STATE OF BEIGHT AND STATE OF BEIGHT AND STATE OF KALAMAZOFFE Number of State of Stat	
FOR REC PM 2	
500 SECOND	
Pagistar an Dando Stamp® Film Number	_

Kalamazoo Corner Code # Located In: 1. Public Land Survey T.3S R 12W C - 022. Property Controlling in Section R 3. Miscellaneous Property in Sec.

_, Recorded Plat 4. Lot No. 5. Private Claims

Robert E. Snell , in a field survey on April 12, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

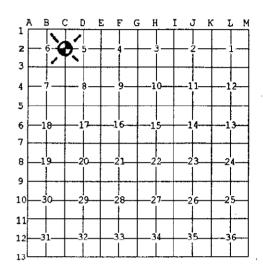

- A. Description of original monument and accessories and/or subsequent restoration:
- United States Government Surveyors; set 1/4 post. 1829:

W. Oak 9"

4 1ks.

W. Oak 10"

S. 57⁰ E. S. 79½° W.

25 1ks.

F. Hodgman, County Surveyor; found 1/4 Section corner, stake hole from stumps of 1870: 2 witnesses. Planted new stake with 4 stones around and marked Hickory 6" N. $31\frac{1}{2}$ W. $13\frac{1}{2}$ lks.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- Found remains of stake hole to a depth of 28" with four large stones around. All four stones were larger than 12"x10"x8" found rotted stake on its side on top of stones.

RATIFIED BY KALAMAZOO COUNTY REMONUMENTATION PEER GROUP

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- East 1/4 post Section 6, T. 3 S., R. 12 W.; ratified on November 21, 1996 by the Kalamazoo County Remonumentation Program Peer Group and is accepted as a careful and faithful perpetuation of the position of the original corner. Found remains of stake hole with four large stones around as set by F. Hodgman, County Surveyor in a survey in 1870. Placed a 30" Harrison Monument in place of stake hole and left four stones around it.

20" Oak 28" Hickory PK Nail in East Side PK Nail in North Side PK Nail in West Side 16" Oak PK Nait in West Side Wood Fence Post

48,881 South 134,23 West N. 10° E. 58,65

N. 75° E. 1.98 12-11-96

Signed by Surveyor's Michigan License No.

9734