

**SURVEY & REMONUMENTATION**

**JAN 25 2001**

**LAND CORNER RECORDATION CERTIFICATE**

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

**SECTION**

For corners in  
Lake

Located in: Corner Code#

- 1. Public Land Survey
 

T 17 W	R 11 W	G-4
T	R	
T	R	
T	R	
- 2. Property Controlling in Section
 

S	T	R
S	T	R
- 3. Miscellaneous Property in Sec.
 

S	T	R
S	T	R
- 4. Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

RECORDED  
LIBER **LAKE COUNTY 2144**

**MAY 5 10 26 AM '00**

*Whitney Myers*  
**REGISTER OF DEEDS**

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on March 13, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

**G-4 - 1/4 Corner common to Sections 9 & 10, T17N, R11W**

**A. Description of original monument and accessories and/or subsequent restoration:**

**1838 - J. Hodgson, G.L.O.**

- #1 - 7" Hemlock S48°W 16 Links
- #2 - 14" Sugar N7°W 25 Links

**Undated G. Johnson, Co. Sur.**

- Wagon Skein
- #3 - 22" Elm S31°W 62'

**1952 - G. Blass, LS 5489**

- Found Wagon Skein
- #3 - 22" Elm S31°W 62'
- #4 - 17" Maple N30°E 52.39'
- #5 - 30" Maple S70°E 92.22'

**1981 - C. Cole, LS 17615**

Same witnesses as G. Blass.

**1983 - R.L. Wetherell, LS 24624**

Survey recorded L. 02, Pg. 441.  
Same witnesses as G. Blass.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

I found the old wagon skein 4 feet East of the centerline of North and South road and in line with fences East and West.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found stump, #4 Found in good condition, #5 Found in good condition.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I replaced the wagon skein with a 3/4" x 24" rebar with Lake County Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 14" R. Pine N84°W 30.94' (60d spike in S. side)
- 14" R. Pine N30°W 51.81' (60d spike in N.E. side)
- 24" Maple N33°E 52.17' (nail and washer in N.E. side) #4 (I think Blass used these washers)
- P. Pole N56°E 34.05' (nail and washer S. side)

RATIFIED BY THE LAKE CO. PLATT REVIEW GROUP  
IN ACCORDANCE WITH P.A. 345  
CHAIRMAN R.L.W.  
DATE 4-11-2000

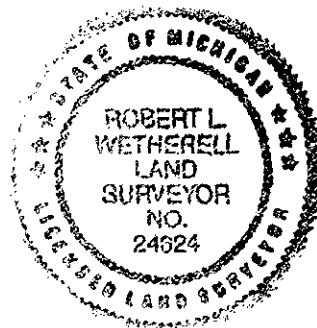

Signed by Robert L. Wetherell  
Surveyor's Michigan License No. 24624

Date April 12, 2000