

JAN 25 2001

**LAND CORNER RECORDATION CERTIFICATE**

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

RECORDED  
LAKE COUNTY, MI.

LIBER 004 PAGE 0245

MAY 5 10 26 AM '00

*Charles W. Myers*  
REGISTER OF DEEDS

**SECTION**

For corners in Lake _____	Located in:	Corner Code#
1. Public Land Survey	T 17 N R 11 W	K-4
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on March 13, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**K-4 - 1/4 Corner common to Sections 11 & 12, T17N, R11W**

**A. Description of original monument and accessories and/or subsequent restoration:**

**1838 - J. Hodgson, G.L.O.**

- #1 - 10" Beech N83°W 28 Links
- #2 - 16" Hemlock S33°W 28 Links

**1921 - G. Johnson, Co. Sur.**

Used corner for road construction  
No accessories given.

**1975 C. Cole, LS 17615**

- L.C.R.C. - L. 02, Pg. 328
- Set 1/2" rebar
- #3 - P. Pole N32°W 47.20'
- #4 - 5" Maple S28°E 54.80'
- #5 - 6" Cherry - West 105.36'

**1992 - R.L. Wetherell, LS 24624**

- #6 - Apple S65°E 28.40'
- #4 - 8" Maple S22°E 54.60'
- #7 - Cor. Fence Post - West 31.98'
- #3 - P. Pole N30°W 47.25'

**1994 S. Barnett, LS 16923**

Survey recorded L. 03, Pg. 481.  
Same witnesses as Cole's in 1975.

**B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:**

I found the 1/2" Capped Rebar (Cole's) in the center of a North and South road and in line fence to West. I measured 2631.22 feet North and 2642.75 feet South to the respective Section corner.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found in good condition, #4 Found in good condition, #5 Found Stump, #6 Found in good condition, #7 Found leaning.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I replaced the 1/2" rebar with a 3/4" x 24" rebar with Lake County Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- P. Pole N30°W 47.23" (60d nail N. side)
- Apple S63°E 28.38' (60d nail S. side)
- 6" Tw. Cherry S24°E 39.20' (nail & tag M.D.O.T.)
- 9" Tw. Maple S17°E 54.63' (60d nail in W. side)
- 10" Tw. Cherry N86°W 89.59' (60d nail S. side)

WITNESSED BY THE LAKE CO. DEED REVIEW GROUP  
IN ACCORDANCE WITH P.A. 345  
CHAIRMAN *R.L.W.*  
DATE 4-11-2000

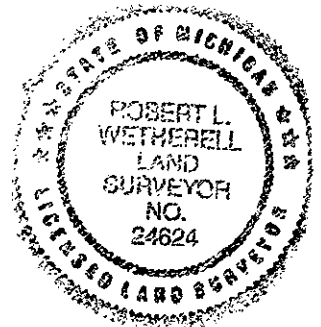

Signed by *Robert L. Wetherell*  
Surveyor's Michigan License No. 24624

Date