

FEB 18 1994

COMMISSION

LAKE COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED LAKE COUNTY, MI.

LIBER 003 PAGE 0198 DEC 13 3 42 PM '93

REGISTER OF DEEDS

For corners in

Table with columns: Lake (County), Located In: (T 17 N 12 W), Corner Code # (E-13). Rows include Public Land Survey, Property Controlling in Section, Miscellaneous Property in Sec.

Register of Deeds Stamp & File Number

- 4. Lot No. Recorded Plat
5. Private Claims

Grid table with columns A-M and rows 2-13. Contains numbers 1-36.

I, Robert L. Wetherell, in a field survey on November 4, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration: E-13 - Section corner common to Sections 32 & 33, T17N, R12W, on the County Line.

1837 - John Hodgson, D.S., G.L.O.

- Placed Wood Stake
#1 8" Pine N36°W 51 Links
#2 8" Aspen N52°E 32 Links

1951 - George Blass, LS 5489

- Found 3/4" Pipe and raised with 1/2" Pipe.
#4 12" W. Oak S35°W 38.30'
#5 20" W. Oak S64°E 47.0'
#6 18" B. Oak N54°E 75.0'

1984 - Clint Cole, LS 17615

Used George Blass's corner and witnesses, (Recorded Act 132 in Liber 03, Page 023).

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-13 - Section corner common to Sections 32 & 33, T17N, R12W, on the County Line.

I found 3/4" pipe and two of Blass's witnesses. I accepted as the corner. Condition of the recorded witnesses are: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Found in good condition, #6 Found stump.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


E-13 - Section corner common to Sections 32 & 33, T17N, R12W, on the County Line.

I replaced 3/4" Iron Pipe with a 3/4" x 24" re-rod with Lake County Brass Cap as a substantial marker for the Section corner, and is accepted as a careful and faithful re-establishment of the position of the original corner.

- 28" W. Oak S64°E 47.42' (60d spike in SW side of tree) (#5)
10" R. Pine N31°E 78.14' (60d spike in SE side of tree)
12" B. Oak N40°W 84.23' (60d spike in NE side of tree)
10" W. Oak S44°W 72.60' (60d spike in NW side of tree)

Signed by Robert L. Wetherell Date 12-13-93

Surveyor's Michigan License No. LS 24624

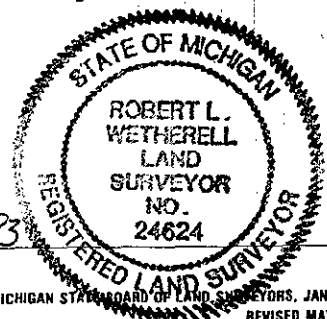

Approved by Peer Review Group December 6, 1993 Robert L. Wetherell, County Representative