

NOV 15 1994

LIBER 003 PAGE 0230

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

For corners in Lake

Table with columns: (County), Located In, Corner Code #. Rows include Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

RECORDED LAKE COUNTY, MI.
REGISTER OF DEEDS
Oct 7 3 46 PM '94

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

Grid table with columns A-M and rows 2-13. A dot is marked at the intersection of column K and row 2.

I, Robert L. Wetherell, in a field survey on April 7, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-1 - (Corner common to Sections 1 and 2, T18N, R11W on North township line)

1838 - John Hodgson - D.S., G.L.O.
#1 - 8" Beech S68°W 33 Links
#2 - 12" Beech S55°E 10 Links
S.W. Corner Section 36 - West 62 Links

1973 - Clinton E. Cole, L.S. 17615
Computed position 40.92 feet (G.L.O. Distance)
East of standard corner on Township line.
He did not monument position.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-1 - (Corner common to Sections 1 and 2, T18N, R11W on North township line)

I set this corner on line between the Southwest corner Section 36 and the South 1/4 corner of Section 36, (T19N, R11W) at a distance of 40.92 feet (62 Links) East of the Southwest corner of Section 36, (G.L.O. record distance).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


K-1 - (Corner common to Sections 1 and 2, T18N, R11W on North township line)

I set a 3/4" x 24" re-bar the with Lake County Brass Cap, and is accepted as a careful and faithful re-establishment of the position of the original corner.

- 6" Maple S24°E 77.01' (60d spike in Southwest side of tree)
6" Maple S78°E 74.66' (60d spike in North side of tree)
8" W. Pine N54°E 53.68' (60d spike in Northwest side of tree)
Railroad tie fence post West 11.26' (60d spike in North side)

Signed by Robert L. Wetherell
Surveyor's Michigan License No. 24624

Date October 4, 1994

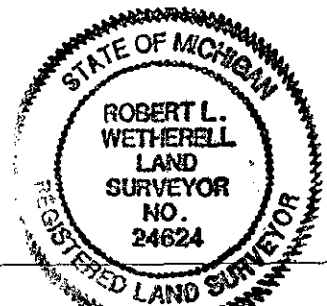

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP
IN ACCORDANCE WITH P.A. 345
CHAIRMAN R.L.W.