

**JAN 25 2001**

**SECTION**

**LAND CORNER RECORDATION CERTIFICATE**

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

For corners in  
Lake \_\_\_\_\_

Located in: Corner Code#

- 1. Public Land Survey  

T 18N	R 14W	G-10
T _____	R _____	_____
T _____	R _____	_____
T _____	R _____	_____
- 2. Property Controlling in Section  

S _____	T _____	R _____
S _____	T _____	R _____
- 3. Miscellaneous Property in Sec.  

S _____	T _____	R _____
S _____	T _____	R _____
- 4. Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

RECORDED  
LAKE COUNTY, MI.

LIBER 004 PAGE 0257

MAY 5 10 27 AM '00

*Shirley Myers*  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on March 13, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

**G-10 - 1/4 Corner common to Sections 27 & 28, T18N, R14W**

**A. Description of original monument and accessories and/or subsequent restoration:**

1838 - S. Sibley, G.L.O.

- #1 - 12" Pine N25°W 14 Links
- #2 14" Pine S34°E 11 Links

1919 - G.H. Johnson, Co. Sur.

- #3 - 10" B. Oak N25°W 35.0'

Undated C. Landon, Unlicensed Sur.

- #3 - 14" B. Oak N25°W 54 Links
- #4 - 8" W. Oak N2°E 50 Links

1952 - G. Blass, LS 5489

"Set 3/4" x 24" Iron Bar by single proportionate method".

- #5 - 10" W. Oak N43°W 10.56'
- #6 - 6" W. Oak S66°E 16.78'
- #7 - N. Railroad Rail S26°W 51.47'

1964 - R.A. Griffin, LS 5489

L.C.R.C. - Liber 01, Pg. 116

"Found 3/4" x 24" bar - replaced with a 5" Square Conc. Monument.

- #6 - 8" W. Oak S66°E 16.85'
- #8 - T. Pole S32°W 94.50'
- #5 - 12" W. Oak N43°W 10.95'
- #7 - Top center railroad rail S26°W 51.65'

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

I found Griffin's 5" Square Concrete Monument 55 feet more or less North of centerline of railroad tracks.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Found in good condition, #6 Found in good condition, #7 Found in good condition, #8 Gone.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I accepted the 5" Square Concrete Monument as a substantial marker for the corner, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 17" W. Oak N38°W 11.12' (60d spike in S.W. side) #5
- 11" Tw. W. Oak S63°E 16.83' (dock spike in S. side) #6
- 6" R. Pine N30°E 36.95' (60d spike in W. side)
- 6" R. Pine S88°E 59.02' (60d spike in N. side)

ATTESTED BY THE LAKE CO. DEED REVIEW GROUP  
IN ACCORDANCE WITH P.A. 345  
CHAIRMAN *R.L.W.*  
DATE *4-11-2000*

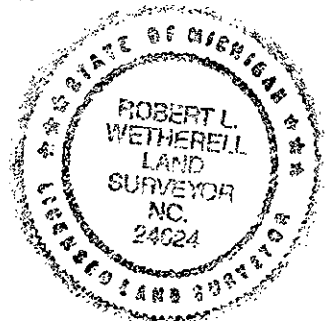

Signed by Robert L. Wetherell  
Surveyor's Michigan License No. 24624

Date April 12, 2000