

JAN 25 2001 LAND CORNER RECORDATION CERTIFICATE
 FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in Lake _____	Located in:	Corner Code#
1. Public Land Survey	T 19 N R 13 W	C-11
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S T R	_____
	S T R	_____
3. Miscellaneous Property in Sec.	S T R	_____
	S T R	_____
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		

RECORDED
 LAKE COUNTY, MI.
 LIBER 004 PAGE 0277
 DEC 8 11 22 AM '00
Robert L. Wetherell
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on February 23, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

C-11 - Section corner common to Sections 29, 30, 31 & 32, T19N, R13W

A. Description of original monument and accessories and/or subsequent restoration:

1838 - S. Sibley G.L.O.

#1 - 8" Pine N33°E 38 Links
 #2 - 6" Pine S44°W 32 Links

1977 - R.L. Wetherell, LS 24624

Measured 2639' East to the ¼ corner and 2714' South to the ¼ corner. No accessories given.

1989 - C. Cole, LS 17615

Measured 2639' E. to ¼ cor. Measured 2714' N. to ¼ cor.

Undated - R. Hollister

(Deputy Co. Surveyor)
 #3 - 14" Y. Pine S22-½°W 2.41 Chains

1986 - K. Ross, LS 17634

L.C.R.C. - Liber 03, Pg. 43. Found nothing - set in computed location. Set U.S.F.S. Monument
 #4 - 10" B. Oak S41°W 73.55'
 #5 - 24" B. Oak N77°W 83.61'
 #6 - 12" W. Oak S86°W 92.40'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found a 5" Square Concrete Monument 114 feet West of the centerline of trail road. Ross's position fits well with survey by Wetherell in 1977.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Found in good condition, #5 Found in good condition, #6 Found in good condition (Found S86°E)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted the 5" Square Concrete Monument as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 12" W. Oak S87°E 92.41' (60d spike in S. side) #6
- 5" B. Oak N3°W 34.62' (60d spike in W. side)
- 28" B. Oak N75°W 83.69' (60d spike in S. side) #5
- 12" B. Oak S43°W 73.52' (60d spike in S.E. side) #4
- 8" B. Oak S16°E 31.06' (60d spike in E. side)

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP
 IN ACCORDANCE WITH P.A. 345
 CHAIRMAN *R&W*
 DATE 12-5-2000

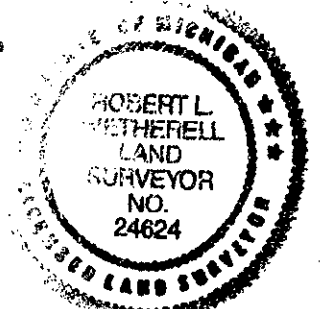

Signed by *Robert L. Wetherell*
 Surveyor's Michigan License No. 24624

Date Dec. 6, 2000