

REMONUMENTATION

MAR 29 1999

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in SECTION

LAPEER
(County)

Located In:
DRYDEN TWP

Corner Code #

435

RECEIVED FOR RECORD
99 JAN -6 PM 1:20

Melissa De Vaughn
REGISTER OF DEEDS
LAPEER COUNTY, MICHIGAN

- 1. Public Land Survey T 6N R 11E L-3
T _____ R _____
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

435

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Shelby W Money, in a field survey on October 8,
19 98 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner
points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in
the current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above
were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law;
established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2			1	
3													
4	7		8		9		10		11			12	
5													
6	16		17		16		15		14			13	
7													
8	19		20		21		22		23			24	
9													
10	30		29		28		27		26			25	
11													
12	31		32		33		34		35			36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1816 GLO by Wampler, set a post common to sections 1 & 12 40 chains
east of southwest corner section 1.

- 1. L2, Pg 222 June 1973 survey by Henderson Bates, Found a 1/2" iron.
- 2. L2, Pg 228 June 1973 survey by Henderson Bates, Found a 1/2" iron.
- 3. L3, Pg 351 July 1975 survey by Kay Engineering, Found 1/2" iron.
- 4. L3, Pg 465 November 1975 survey by Henderson Bates, Found a 1/2" iron.
- 5. L5, Pg 522 November 1979 survey by Henderson Bates, Found a 1/2" iron.
- 6. L6, Pg 611 August 1983 survey by Henderson Bates, Corner not identified.
- 7. L6, Pg 615 September 1983 survey by Henderson Bates, Found a 1/2" iron.
- 8. L6, Pg 636 June 1983 survey by Kobs Land Surveying, Found a 1/2" iron.
- 9. L7, Pg 133 August 1985 survey by Henderson Bates, Corner not identified.
- 10 L2, Pg 221, May 1973 LCRC by Harold Elrich, Found a 1/2" iron.
- 11 L4, Pg 64, December LCRC 1982 by Herbert Kobs, Found a 1/2" iron.

PEER GROUP
APPROVED LAND CORNER
PA 313 OF 1980
LAPEER COUNTY

RAY DAVID P.S. CO. SURVEYOR
DATE 10-13-98

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" iron in 3' south of centerline of Hollow Corners Road which extends east and west and has a gravel
surface. Corner is 34' east of the centerline of Meadow Lane (Private) which also has a gravel surface

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-3 Placed 2" diameter brass cap stamped LAPEER COUNTY REMONUMENTATION, PS#30092 on found 1/2"
iron,

- 1. Az 30° 25.99' to a P. K. nail found in southeast face of a 12" ash.
- 2. Az 160° 92.70' to P. K. nail & Lapeer County Remon Tag set in east face of a utility pole.
- 3. Az 260° 68.93' to P. K. nail found in north face of a triple osage orange 8"-8"-8".
- 4. Az 295° 75.87' to P. K. nail found in south face of a 20" elm.
- 5. Az 355° 19.23' to P. K. nail found in east face of a 12" elm.


FIELD MEASUREMENTS

L-3 TO K-3 2659.63' GLO 2640.00

L-3 TO M-3 2694.07 GLO 2708.64'

THE SELECTED LOCATION IS ACCEPTED BY ME AND IS GENERALLY ACCEPTED BY PROFESSIONAL
SURVEYORS AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Shelby W Money Date 12/22/98
Surveyor's Michigan License No. 30092

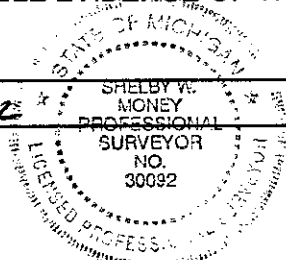

A