## SURVEY & REMONUMENTATION

Filed under Remonumentation Act 345 of 1990

APR 28 1995

## LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 001 PAGE 50

## COMMISSION

on this certificate.

i di comera m								
Lenawee (County)	Located in:	Corner Code #		F	ILED	2	;0€	p.m.
1. Public Land Survey	T <u>- 6 - \$</u> R <u>- 5 - E</u> T R T R	<u>E-8</u>		LENAV	0 5 199 VEE COUN	)4 ty		
Property Controlling     in Section	T R S T R S T R		Regis	REGIST	TTE D. I'N ER OF DEE eeds Stan	DS	le Nu	mber
Miscellaneous     Property in Sec.	STR STR		1	АВС	DEF	GН	IJ	KLN
	Recorded Plat		2 3		5 - 4	3	2	
			4 5	7-1	- <del>                                      </del>	10-	11	12
do hereby certify that under	requirements of P.A. 74, Michigan re in conformance with regulations	P.A. of 1970, the corner points me	entioned 7		17 16 20 <b>■</b> 21		23	13
current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a  Court of Law; established, re-established, monumented, re-monumented, recovered, found as						25		
expressed below:  NOTE: Not more than 4 corners, all in the same town and range, may be recorded				31	32 33	34	35	36

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. August 1819, Joseph Fletcher set 1/4 post, Maple 4 S 23 E 7, W. Ash 10 S 68 W 9 J.L. Richard record from early 1900's show distances from the center and 1/8 corner in Section 20. December 8, 1977, K.L. Suydam doubled the distance between the occupied Center of Section 21 and the occupied 1/8 corner in Section 20 and set 1/2" X 14" iron pipe in line of end post on West side of road and recorded it in L.5, P.4, nail & shiner in Elec. pole N 30° W 82.25.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

11-10-93, I found the iron pipe hit and bent. I re-traced the K.L. Suydam survey to re-set the iron and hit a stone. Dug and found pointed stone 14" deep, set 3/4" X 12" iron pipe over stone which checked the K.L. Suydam survey and witnesses.


10-26-94, Removed the 14" iron pipe and set 3/4" X 3' iron pipe capped P.S. 13040 in monument box. I drove the iron pipe beside the stone and bent the top of it so as to be at the location of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

3/4" X 3' iron pipe capped P.S. 13040 in a monument box and is accepted as the best available evidence of the position of the original corner.

Cut "X" on C.M.P. N 50° W 23.28 Cut "X" on C.M.P. N 55° E 24.27 Dbl. hd. nail & disc. in Elec. pole N 30° W 80.83 Fd. nail & disc. in Elec. pole (top cut off) N 30° W 82.25 Face of 2 1/2" galv. post West 26.30

Surveyor's Michigan License No. 13040

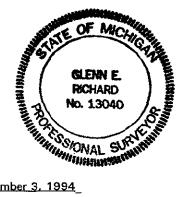

Ratified by Peer Group in accordance with P.A. 345	Co. Rep. Alenn & Richard Date November 3, 1994
Ratified by Peer Group in accordance with P.A. 345 Signed by Henn & Ruhard	Date <u>Nov-11, 199</u> 4
Glenn E. Richard	•

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971