

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

4 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>45</u> ^{N.} / _{S.} , R. <u>10</u> ^{E.} / _{W.}	<u>H-11, H-12</u>
2. PROPERTY CONTROLLING IN SECTION <u>34</u>	T. <u>45</u> ^{N.} / _{S.} , R. <u>10</u> ^{E.} / _{W.}	<u>5-Sec.34, 4-Sec.34</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} / _{S.} , R. _____ ^{E.} / _{W.}	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-13, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- H-11 Quarter Corner bet. Sec's. 27-34, set by Wm. Ives, D.S. in 1849.
Bearings were: Sugar 14", N61°E, 23 lks. and Sugar 6", S30°W, 22 lks.
- 5-Sec.34 North 1/16 Corner of Section 34.
- H-12 Center Corner of Section 34.
- 4-Sec.34 NorthEast 1/16 Corner of Section 34.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- H-11 Re-established corner midway bet. two Sec. Cors. Found no evidence of original corner.
- 5-Sec.34 Placed corner midway bet. $\frac{1}{4}$ Corner to North and Center Corner to South.
- H-12 Placed corner at intersection of lines connecting opposite $\frac{1}{4}$ corners.
- 4-Sec.34 Placed corner at center of the NorthEast quarter section.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners.

- H-11 New Bearings: 10" Hard Maple, S80°E, 13.0' and 8" Hard Maple, N21°E, 50.6'
- 5-Sec.34 Bearings: 10" Hard Maple, N13°E, 7.5' and 9" Hard Maple, S66°E, 11.8'
- H-12 Bearings: 11" Soft Maple, S70°W, 8.1' and 19" Hard Maple, S13°E, 7.0'
- 4-Sec.34 Bearings: 10" Hard Maple, N31°E, 14.7' and 11" Hard Maple, S30°E, 25.9'

SIGNED BY Billy D. Buckler
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

DATE 1-27-77

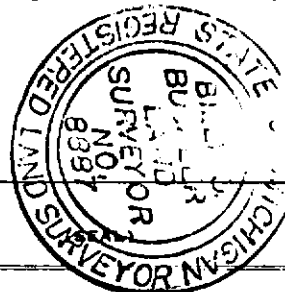

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____