SURVEY & REMONUMENTATION

MAR I 9 1999

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 **Luce County Remonumentation Corner**

For corners in SECTION

Corner Code # Located in: **Luce County** M-11 Same 1. Public Land Survey T45N R11W **T45N R10W** A-11: Corner » Т R T R 2. Property Controlling R T T R in Section S Miscellaneous S T R Property in Sec. S

LUCE COUNTY REGISTER OF DEEDS Pecorded

ber 3 page 830

Mahar, Registe REGISTER OF DEEDS

Register of Deeds Stamp & File Number


4. Lot No.

. Recorded Plat

5. Private Claims

I, William L. Karr, in a field survey on December 7, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below;

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

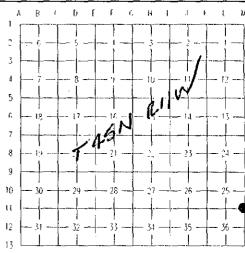

A. Description of original monument and accessories and/or subsequent restoration:

(M-11) Section Corner Common to Sections 25 & 36, T. 45 N., R. 11 W. and Sections 30 & 31, T. 45 N., R. 10 W.

1841 John Burt set a post for the corner in the original survey.

Witnesses

6" Black Cherry

N 57° E

8 lks

6" Birch

N 21° W

32 lks

1967 Billy Buckler, P.S. 8887, re-established the corner by single proportionate measurement between section corners one mile North and one mile South. Buckler set a 1" pipe with a 4" aluminum cap and recorded the corner in 1970 in page 722, Luce County Corner Records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(M-11) Section Corner Common to Sections 25 & 36, T. 45 N., R. 11 W. and Sections 30 & 31, T. 45 N., R. 10 W. This corner is being perpetuated as part of the Luce County Remonumentation Program.

Recovered corner as monumented by Buckler in 1967. The monument falls 1.59' West and 2.63' South of a point midway and on line between the section corners one mile North and one mile South. Could find no evidence of the original corner or any other contrary evidence and accepted the corner as recovered.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(M-11) Section Corner Common to Sections 25 & 36, T, 45 N., R. 11 W. and Sections 30 & 31, T. 45 N., R. 10 W.

Corner is a 1" pipe with a 4" Dept. of Conservation aluminum cap, 1' above ground. The corner fails on a North-South

ridge in the hardwoods +/- 100' South of old East-West grade. Witnesses: Maple Post

North 1.0 Sugar Maple 15" N 12° E 29.00' Red Maple 22" N 90° E 9.02 Sugar Maple 14" S 20° W 13.75 Sugar Maple 10" S 64° W 28.93' Sugar Maple 17" N 80° W 25.18

KARR LAND SURVEYOR

Bearings are compass bearings, corrected for declination, all distances are to a nail and tag in the side of the otherwise noted.