

**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Luce	Located In:	Corner Code #
(County)		
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>23</u> T <u>47N</u> R <u>9W</u>	<u>12</u>
	S <u>23</u> T <u>47N</u> R <u>9W</u>	<u>15</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Oct 14 1999

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6	5	4		3		2		1			
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

**A. Description of original monument and accessories and/or subsequent restoration:**


(12-Sec. 23) South 1/16 corner, Section 23. Established in 1978 by Billy D. Buckler, RLS. Set D.W.R. monument. 6" J. Pine N15W 27.9', 8" J. Pine S73W 18.65', 10" Spruce S34W 37.05'.  
 (15-Sec. 23) West 1/16 corner between Sections 23 & 26. Corner established in 1965 by F.J.Bray, RLS. 1" iron pipe with 4" aluminum cap. 5" J.Pine N76W 41 links, 7" J.Pine N28E 84 links.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(12-Sec. 23) Recovered the 1978 monument as described, a 1" ID iron pipe capped with a 4" dia. aluminum MDNR tablet, in good condition, at record bearing and distance from the 1978 witnesses. The 8" J. Pine is dead but standing. The 10" Spruce has been cut. Left the monument in place and made new witnesses as described below.  
 (15-Sec. 23) Recovered the 1965 monument, as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum Michigan Dept. of Conservation tablet, in good condition, at record bearing and distance from the two 1965 witnesses, now both dead. Left the monument in place and marked new accessories as described below.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(12) Found 1" pipe with MDNR cap. Blazed, scribed, and set measuring nails in the following: 5" B.Spruce S10W 7.6'      "S1/16 BT" 4" Tamarack N76E 3.7'      do 6" B.Spruce N89W 13.6'      do The 1978 witness 7" J. Pine N15W 28.0' Placed a squared and scribed post adjacent. Bearings are magnetic. Dist. to measuring nail.	(15) 1" pipe with 4" aluminum cap. Blazed, scribed, and set measuring nails in the following: 3" Tamarack S16W 6.3'      "N1/16 BT" 6" Tamarack N40E 67.65'      do 3" J.Pine N60E 13.6'      do 6" Tamarack N05W 41.5'      do Placed Tam. stake adjacent. Bearings are magnetic. Distances are to meas. nail.
--	---

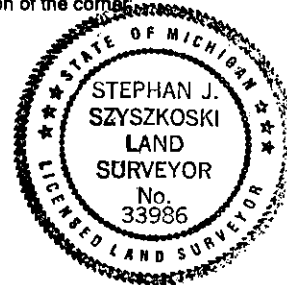

Signed by Stephan J. Szyszkoski Date 3/20/00  
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division