

**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Luce	Located In:	Corner Code #
<small>(County)</small>		
1. Public Land Survey	T <u>47N</u> R <u>9W</u>	<u>I9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Oct 14 1999

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9									●				
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:  
 (I9) Corner common to Sections 22-23-26-27. Corner reestablished by double proportionate measurement in 1965 by F.J. Bray, RLS. 1" iron pipe with 4" aluminum cap. 8' J. Pine N45E 47 links, 7' Tamarack S77W 92 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(I9) Recovered the 1965 monument, as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1965 witnesses. The 8" J. Pine is dead but standing. The 7" Tamarack is alive and in good condition with blazes plain. Left the monument in place and made new accessories as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 (I9) 1" pipe with 4" aluminum cap.

Blazed, scribed, and set measuring nails in the following:

- 7" Tamarack S81W 61.1' "S27 NBT"
- 4" J. Pine S78E 14.6' "S26 NBT"
- 6" J. Pine N38E 26.5' "S23 NBT"
- 3" J. Pine N35W 11.65' "S22 NBT"

Placed a 4" squared and scribed cedar post adjacent. Bearings are magnetic. Distances are to meas. nail.

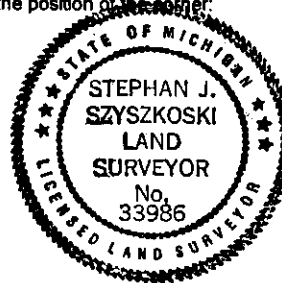

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 3/20/00

For the Michigan Department of Natural Resources - Forest Management Division