


**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Luce	Located In:	Corner Code #
<small>(County)</small>		
1. Public Land Survey	T <u>47NR</u> <u>11M</u>	<u>I13</u>
	T <u>    </u> <u>    </u>	<u>    </u>
	T <u>    </u> <u>    </u>	<u>    </u>
	T <u>    </u> <u>    </u>	<u>    </u>
2. Property Controlling in Section	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
3. Miscellaneous Property in Sec.	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>

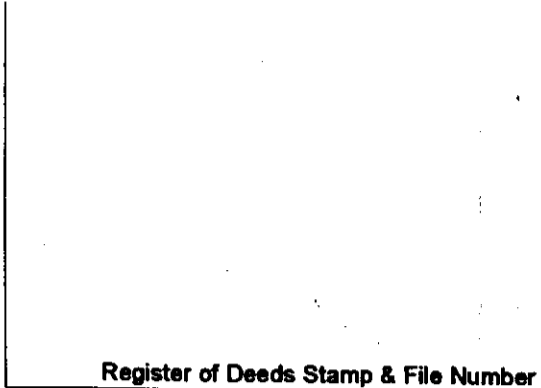

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Oct 21 2002

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 20\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

(I13) Corner common to Sections 2-3 T46N-R11W and 34-35 T47N-R11W. 1841- Established by John Burt for Mm A. Burt: West on South side Sec. 35...40.00 Set qr section post. W.Pine 22 N35E 12, Fir 10 N29W 13. 1851- additional witnesses by Francis Coleman: Beech 7 S59E 8, Fir 10 S51W 36. 1960- Reestablished by Billy D. Buckler by double proportionate measurement from corners 1 mile north, 1 mile south, 1 mile west, and 1/2 mile east. No evidence of original corner. Set 1" pipe with 4" brass cap. 13" W.Pine S54E 116 links, 16" W.Pine stump S12W 64 links, 20" W.Pine stump N39W 78 links.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(I13) The original post and accessories were not recovered. Found the 1960 monument in good condition, at record bearing and distance from the 13" W.Pine NBT (now a cut stump). Did not accept the monument as marking the position of the corner. It was established using improper procedures. the monument seems not to have been relied upon but by the MDNR, on whose behalf I conduct my survey. I reestablished the corner by single proportionate measurement to the original record between perpetuations of what are described in the record as "probable" original corners 5293.06' west and 2646.53' east. The monument was installed on the curved township line, the mean true bearing of which is N 89 deg. 56' 01" W. The position falls about 25' west of a trail road and is 21.96' northerly from the 1960 position.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(I13) Set 1"IDx36" I.pipe with 4" dia. alum. MDNR cap. Blazed, scribed, and set measuring nails in:  
 10" Spruce S33E 28.9' "S2 NBT"  
 24" W.Pine S87E 58.35' do  
 14" R.Pine N18E 83.8' "S35 NBT"  
 10" W.Pine S73W 86.9' "S3 NBT"  
 Bearings are magnetic. Distances are to nail with tag. Set a cedar post adjacent.



Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 12/10/02