

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Luce		Located In:		Corner Code #	
(County)					
1. Public Land Survey		T49N R10W		83	
		T	R		
		T	R		
		T	R		
2. Property Controlling in Section	S 6	T49N R10W		14	
	S	T	R		
3. Miscellaneous Property in Sec.	S	T	R		
	S	T	R		

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Jun 06 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3			•										
4		7		8		9		10		11		12	
5													
6		10		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

**A. Description of original monument and accessories and/or subsequent restoration:**


- (83) Quarter corner common to Sections 6 & 7. Remonumented in 1952 by Dean C. DeLaMater RLS : "This corner was pointed out to me by B. McTiver, District Forester, of Newberry. One original 0.T. still in place, fair condition". 1" pipe with 4" brass cap. 14" Red Pine N44W 38 links.
- (14-Sec. 6) South 1/16 corner between Sections 5 & 6. Established in 1965 by F.J. Bray RLS midway and on line between 1/4 Corner to North and Section Corner to South. 1" iron pipe with 4" aluminum cap. 8" Jack Pine N32W 17.5 links, 12" Jack Pine S38W 31 links.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

- (83) Recovered the 1952 monument, as described, in good condition, at record bearing and distance from the Red Pine NBT, which is in good condition. Also recovered a 14" J. Pine marked as an accessory unknown years ago, having overgrown blazes facing the corner (noted below). Left the monument in place and made new accessories.
- (14-Sec. 6) Recovered the 1965 monument, as described but capped with a fractured aluminum tablet, at record bearing and 17.5 links from the Jack Pine SW NBT, in good condition with overgrown blazes. The Jack Pine NW is dead and gone. It appears that the distances to the NBTs had been transposed on the 1965 record. Left the monument in place and made new accessories as described below.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- |   |   |
|---|---|
| (83) Found 1" ID iron pipe with 4" brass State of Michigan tablet. Blazed, scribed, and set measuring nails in: | (14-Sec. 6) Found 1" ID iron pipe with 4" alum. State of Michigan cap. Blazed, scribed, and set meas. nails in: |
| 16" R.Pine N42W 25.2'      "1/4S"   | 14" J.Pine S40W 12.0'      "S1/16"  |
| 14" J.Pine S02W 27.5'      "1/4S"   | 5" J.Pine S29E 7.9'      "S1/16 BT"   |
| 8" J.Pine N12W 7.2'      "1/4S NBT"   | 4" J.Pine N23W 4.9'      do   |
| 8" J.Pine S43E 29.0'      "1/4S NBT"  | 10" J.Pine N79W 56.5'      do   |
| Bearings are magnetic. Distances are to nail with tag.  | Set cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.                                 |

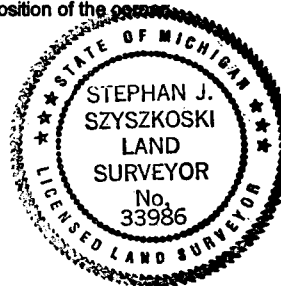

Signed by Stephan J. Szyszkoski Date 12/3/01  
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Office of Property Management