

**SUI. J. &
REMONUMENTATION**

DEC 13 1993

COMMISSION

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

NOV 29 3 37 PM 1993
 NANCY HAVILAND
 REGISTER OF DEEDS
 LIVINGSTON COUNTY, MI
 48843

For corners in

Livingston
(County)

Located In:

Corner Code ##

- | | | | |
|------------------------------------|--------------|--------------|-------------|
| 1. Public Land Survey | T <u>2</u> N | R <u>4</u> E | <u>I-11</u> |
| | T _____ | R _____ | _____ |
| | T _____ | R _____ | _____ |
| | T _____ | R _____ | _____ |
| 2. Property Controlling in Section | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |
| 3. Miscellaneous | S _____ | T _____ | R _____ |
| Property in Sec. | S _____ | T _____ | R _____ |

L.S.C. #45m

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Darnell D Hughes in a field survey on October 22, 1993

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

GLO survey Notes: April 15, 1825
 GLO witnesses: BO 4-S3E-.97 ch.
 WO 6-N79W-1.88 ch


Additional historical data on rear of sheet:

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Found 1/2" I. Rod with PL Benton cap on top.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-11: NW cor. Sec. 35, T2N-R4E, reset with 1 1/4" X 36" breakaway I. Pipe with Liv. Co. brass cap on top.
 West-49.41'-sp N/s 10" Oak
 N45W-35.78'-sp W/s 40" Oak
 N10E-36.55'-sp E/s 15" Hickory
 N70E-84.30'-sp S/s 48" Oak
 S20E-34.89'-sp E/s 15" Hickory
 On ctr. of Road to East
 North-10'±- to existing ctr. of Road.

Signed by Darnell D Hughes Approved by Liv. Co. Peer Group: Oct. 30, 1993
 Date 11-29-93
 Surveyor's Michigan License No. 19834

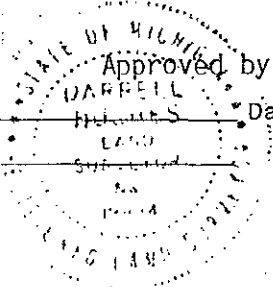

October 23, 1993

I-11: NW Cor. Sec. 35 Marion Twp. Liv. Co. MI

Found $\frac{1}{2}$ " iron rod with cap (-.5') instead of the iron pipe set by C.W. Gordon, Co. Surveyor, in 1942 and which I found in 1964 as per Gordon witnesses. The two Oaks Gordon measured to in 1942 are still present today; Elm is gone. I dug down below $\frac{1}{2}$ " iron rod and found old post hole rung with stones below which checked again as per 1942 notes of Gordon. The $\frac{1}{2}$ " iron rod was set by P.L. Benton at the time he platted "Sierra Grand Subd." L18, pg.33-36 Livingston Co. Records. Known surveyors to use this same Corner are: C.W. Gordon, L.W. Munsell, P.L. Benton and C.E. Garlock. No Act 74's have been files. Sweep of area found no additional irons. Trees are hanging over road and Corner; Corner set in gravel road.
