

SURVEY & REMONUMENTATION

DEC 13 1993

COMMISSION

For corners in
Livingston
(County)

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Located In: _____ Corner Code # _____

- | | | |
|------------------------------------|-------------------------|-------|
| 1. Public Land Survey | T <u>2N</u> R <u>4E</u> | K-12 |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

NOV 29 3 37 PM '93
 NANCY HAYLAND
 REGISTER OF DEEDS
 LIVINGSTON COUNTY, MI
 48843

RECORDED
 FILED

L.S.C. #51m

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Darrell D Hughes, in a field survey on October 22, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.


- A. Description of original monument and accessories and/or subsequent restoration:
 GLO survey notes: April 15, 1825
 GLO witnesses: W0 24-S45E-1.06 ch
BQ 9-N38W-.35 ch

Additional historical data on rear of sheet:

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Found 3/4" X 30" I. Rod set by PL Benton in 1981

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 K-12: W 1/4 cor. Sec. 36, T2N-R4E, witnessed found Iron Rod and set Liv. Co. brass cap on top.
S25E-68.72'-NW corner of House foundation
S80E-10.31'-sp N/s 8" Box Elder
N5E-45.60'-SE cor. Shed
N50W-48.78'-SE cor. Concrete block Garage
S15W-95.0'-ctr. 12" maple
S2E-84.15'-ctr. 4" Water Well

Signed by Darrell D Hughes
 Surveyor's Michigan License No. 19834

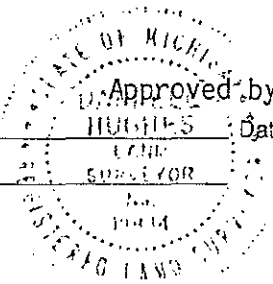

Approved by Liv. Co. Peer Group: Oct. 30, 1993
 Date 11-29-93

October 23, 1993

K-12: W 1/4 Cor. Sec. 36 Marion Twp. Liv. Co. MI

Found 3/4"x30" iron rod set by P.L. Benton in 1981. Earliest known witness is 1877 by M.W. Bullock which is gone. In a 1954 survey by L.W. Munsell the 1/4 Corner was established in an existing East-West fence line and on the extended center-line of Pinckney Rd. from the South and he measured West along the fence 158.5' to the old center-line of Pinckney Rd. In 1961 and during the survey of the Pinckney Rd. reconstruction the same measure existed. In 1969 C.E. Garlock measured 145.18' to the new center-line of Pinckney Rd. as it was relocated Easterly and measured the same now. A measure South by Boss Engineering in 1990 of 2639.60' to the SW Corner of Sec. 35 was the same I had in 1969. Witnesses by P.L. Benton and Boss Engineering are to the same point. The iron is located on the side slope of a bank sloping south and in a hedge-row East-West.