For corners in

LAND CORNER RECORDATION CERTIFICATE

COMMISSION

Filing Requirement of Act 74, Mich. P.A. 1970

Livingston Localed In: Corner Code =## Public Land Survey T <u>2N</u> R <u>5E</u> · ____R_ ___ R __

___ R _

L.S.C.#461m

Register of Deeds Stamp & File Number

2. Property Controlling __ R __ _ T __ in Section __ T ____ R . Miscellaneous S _ T __ ___ R _ Property in Sec.

4. Lot No. __ . Recorded Plat Private Claims _


¬._Bryan_Boss_ ., in a field survey on . -do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned In lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 ■bove were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Dourt of Law; established, re-established, monumented, re-monumented, recovered, found as ∋xpressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Set post at average distance on traverse line for { section corner.

White Oak 10" S 19} E 69 1inks WHite Oak 8" N 7 E 1.17 chains Hickory 6" S 53 3/4 W 38

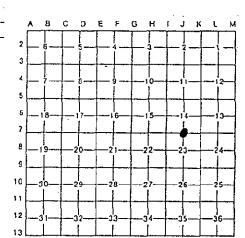

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

3/4" iron found on centerline Crooked Lake Road extended and tree row, South. South 21.33' spike 24" Oak N 55 W 52.40' spike 14" Oak West 39.97' 1" iron rod in fence Northeasterly 66.44 nearest edge of pavement

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 36" pipe 6" deed with brass cap 5.93 N 450 E nail & tag East side 6" Poplar 21.46 South nail & tag West side 24" Oak 21.32 West Norhterly "Road End" sign 39.46 West Garlock iron in fence 52.20 N 55° W nail & tag North side 14° Oak THE OF MICH BRYAN L BOSS Land Surveyor NO. 29238 ķΩ HAND LAND LAND SU

1995 _ Date _

urveyor's Michigan License No. 29238

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975

SUMMARY

J-7

North $\frac{1}{4}$ Corner, Section 23, T2N-R5E, Genoa Township, Livingston County, Michigan.

Found 3/4" iron in I-96 Expressway right-of-way on line with Crooked Lake Road extended and tree row Southerly.

Measured to Witnesses found. M.D.O.T witnesses check (page 16B). Charles Garlock Witnesses (page 17, 19, 20, 24) check. Boss Engineering survey (page 21A) witnesses check. All surveys in dossier use this point.

Boss Engineering Witnesses on Act 74 (L.S.C. No. 1070) are for L-7, North 1 Corner of Section 24, T2N-R5E or T2N-R6E. (see page 12). Pat Benton Witnesses (page 14) are in Oceola Township, Section 4, but legal description is in Genoa Township.

Note distances on M.D.O.T. maps pages 15, 16 are measured to East bound I-96 construction centerline. After inserting the 126.05 feet difference on page 6, the overall distance between section corners are more in line with measured $\frac{1}{2}$ miles by Charles Garlock and Boss Engineering.

This Corner has over hanging branches which will not be conducive for G.P.S..

Conclusion:

We find that the Witnesses found on Charles Garlock Survey (page 24 dated May 7, 1994 should be held and pipe set accordingly.

GENJ-7S

BRYAN L. BOSS Land Surveyor NO. 29238

LAND SURTE