

JUL 14 9 46 AM '95

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

LIVINGSTON
(County)

Located in:

Corner Code #

NANCY HAVILAND
REGISTER OF DEEDS
LIVINGSTON COUNTY, MI
48843

- 1. Public Land Survey T 4N R 4E F-11
- T _____ R _____
- T _____ R _____
- T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
- in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
- Property in Section S _____ T _____ R _____

L.S.C.#413 m

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2				
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Edward E. Anderson, field survey on June 26, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. NOTES DATED June 20, 1823
 G.L.O. WITNESSES W. Oak 20" S32 1/2° W 20 Lks
 W. Oak 16" N62°E 11 Lks


Additional historical data on back

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F 1 1/2" iron pipe fit witnesses by Boss, Benton, and Hughes

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-11 N 1/4 COR SEC 33, T4N-R4E
 Set 36" x 1 1/4" iron pipe with Brass cap 15' north of centerline of Geer Road
 N 03°E 19.72', spike W/S 24" Oak
 S 32°E 69.71', spike W/S 14" Oak
 S 12°W 52.35', Spike E/S Power Pole
 N 62°W 58.16', Spike S/S 18" Oak

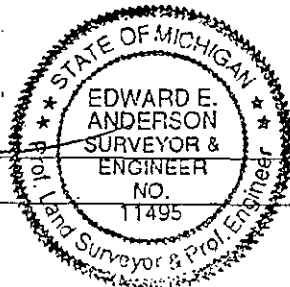

Signed by Edward E. Anderson
 Surveyor's Michigan License No. 11495

Date July 5, 1995

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983

P.A. 345 1990, APPROVED BY LIVINGSTON COUNTY
 PEER GROUP ON 4-5-95, CO. REP. JED



EDWARD E. ANDERSON, P.S., P.E.
RICHARD F. FRANK, P.S.
BRIAN R. SHALTZ, C.S.T.

Members of:
Michigan Society of Professional Surveyors
American Congress on Surveying and Mapping
American Society of Civil Engineers

401 S. Leroy St.
Fenton, Michigan 48430-2164

(313) 629-8974
FAX (313) 629-9069

SUMMARY

March 23, 1995

F-11 NORTH 1/4 CORNER SECTION 33, T4N-R4E, COHOCTAH TOWNSHIP,
LIVINGSTON COUNTY, MICHIGAN.

Found 1 1/2" pipe 2' above ground and 15' north of the centerline of Geer Road (gravel) running east and west.

Checked and measured to witnesses we found. Found all of Boss and Benton witnesses and they checked, pages 10 and 12 this dossier. Found all of Hughes witnesses and they checked, page 14 this dossier.

Distance from the North 1/4 corner to N.W. corner of said Section 33 is 2637.32', Boss survey, page 9 this dossier; and 2637.23' Hughes survey, page 13 this dossier, and 2637.34' Benton surveys pages 11 and 12.

Distance from North 1/4 corner to the N.E. corner of said section 33 is 2649.92', Hughes survey, page 13, this dossier.

Made a clean sweep of immediate area and found no other corners or irons.


Gravel road running East and west. Flat to the east and falls to the west.

Terrain is wooded in all directions. House to the N.E., N.W. and S.W.

Tree line to the south.

Poor location for G.P.S.

Came to the conclusion that the 1 1/2" pipe we found is the correct North 1/4 corner of said Section 33.


Edward E. Anderson
P.S.#11495

