

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---|-------------|
| 1. Public Land Survey | T <u>42N</u> R <u>11W</u> | <u>F10</u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| 2. Property Controlling in Section | S <u>21</u> T <u>42N</u> R <u>11W</u> | <u>12</u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| 3. Miscellaneous Property in Sec. | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Nov 29 2004

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

- A. Description of original monument and accessories and/or subsequent restoration:**
 (F10) Center of Section 28. Not established in the original survey.
 (12-Sec. 21) South 1/16 corner, Section 21. Not established in the original survey.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**
 (F10) Established the corner at the intersection of straight lines connecting opposite Quarter corners.
 (12-Sec. 21) Established the corner midway and on a straight line between Center of Section 1338.43' North and Quarter corner 1338.43' South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|--|---|
| (F10) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. Set measuring nails in:
14" W.Birch S10W 37.6' mrkd "CS 8T"
10" Beech N65W 14.4' do
14" Beech N13E 26.3' do
6" Beech N80E 20.25' do
Set cedar post adjacent. Bearings are magnetic. Distances are to nail with tag. | (12) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. Set measuring nails in:
12" Maple N80E 20.1' mrkd "S1/16 8T"
5" Maple N39E 16.95' do
6" Beech N59W 31.2' do
10" Maple S29E 26.3' do
Set cedar post adjacent. Bearings are magnetic. Distances are to nail with tag. |
|--|---|

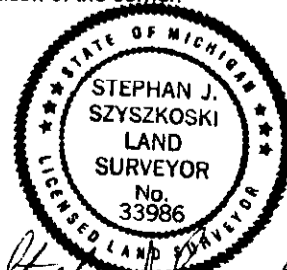

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 12/7/04