

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located in:

Corner Code #

1. Public Land Survey	T <u>42N</u> R <u>11W</u>	<u>68</u>
	T <u>42N</u> R <u>11W</u>	<u>69</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Nov 22 2004

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:


(68) Quarter corner common to Sections 21-22. 1850 - Established by Wm. Ives, Deputy Surveyor: S33°W corrected between Sections 21 & 22 ...40.70 Set quarter Section post. Sugar 14 N58W 27 links, Sugar 14 S49E 27 links. ...81.40 Section corner.
 (69) Section corner common to Sections 21-22-27-28. 1850 - Established by Wm. Ives, Deputy Surveyor: N33°E corrected between Sections 27 & 28 ...81.40 Post Set corner of sections 21,22,27,28. Sugar 14 S39E 53 links, Yellow Birch 16 N43W 12 links. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(68) The original post and accessories were not recovered. Reestablished the corner at the proportionate position, midway and on line between Section corners 2675.12' North and South. From the corner thus established, the center of a N-S trail is 7 feet East.
 (69) The original post and accessories were not recovered. Reestablished the corner in accord with local evidence: at the intersection of centerline of trail road to north with the westerly extension of an old stone fence to east. The position thus established fits closely the average centerline of an old trail road running west and is 33' south of an old wire R/W fence running west. Distances north and south to adjacent section corners are 81.0640 chains and 81.1073 chains, respectively (both recorded as 81.40 chains). This corner position is 57.4' east of a straight line between G7 and G11 and is 80.9596 ch. east of reestablished E9 (recorded as 80.16 ch.)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(68) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. Set measuring nails in: 6" Maple S83W 21.95' mrkd "1/4S NBT" 10" Maple N48W 31.85' do 5" Maple N50E 37.9' do 12" Maple S65E 32.9' do Set cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.	(69) Set 1"x36" I.pipe with plastic cap "MICH DNR PS33986", driven flush with the ground surface. Set measuring nails in: 8" Maple S82W 57.95' mrkd "S28 NBT" 8" Spruce S11W 35.85' do 8" Spruce N88E 43.2' mrkd "S22 NBT" 6" Apple N23E 57.4' do Corner lies in C/L intersection of trail roads N and W. Bearings are magnetic. Distances to nail with tag.
--	---

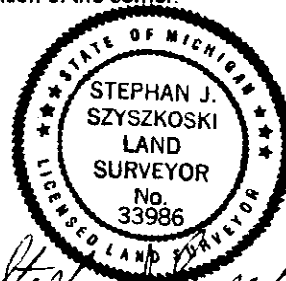

Stephan J. Szyszkoski
 Date 12/7/04

Signed by Stephan J. Szyszkoski Date _____
 Surveyor's Michigan License No. 33986