

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Mackinac</u>	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>42N</u> R <u>11W</u>	<u>E9</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Nov 23 2004

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


(E9) Corner common to Sections 20-21-28-29. 1850 -Established by Wm. Ives, Deputy Surveyor: Set post. Yellow Birch 16 S32E 50 links, Sugar 28 N46W 42 links. Found no subsequent record. Found no record at Mackinac Co. Rd. Commission offices in St. Ignace. GLO record distances north and south to adjacent section corners are 80.66 chains.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E9) The original post and accessories have been destroyed by road construction. Found, but did not accept for the corner, a 5/8" iron pin in a monument box, not of record, 33.0' north of the position subsequently monumented. This 5/8" iron pin was found at the westerly extension of an old wire fence, likely marking the northerly R/W of the ancient road to the east. Local landowner Cheryl Rourke told me she holds that the road along the south line of Sec. 21 is the approximate Sec. line. I reestablished the corner in the center of S. Gould City road 33.0' south of the 5/8" pin in the monument box, the reestablished position also being on the westerly extension of the mean position, as best I could determine it, of the centerline of the old trail road which meanders along the south line of Sec. 21. From the position thus established, E7 is 81.1596 ch. North and E11 is 80.8469 ch. South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E9) Set 5/8"x24" rebar with plastic cap "MICH DNR PS33986" driven flush with the asphalt surface.
 USGS Benchmark TT 91 1929 N40E 50.58';
 5/8" iron pin in mon. box North, 33.0';
 Chiseled "+" in conc. project marker
 N23W 66.17' ; Set nail/tag in power pole
 EN4 177 84, N67W 36.53'. Bearings are magnetic.

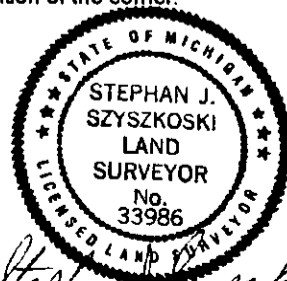

Stephan J. Szyszkoski

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 12/7/04