

**SURVEY &
REMONUMENTATION**

JAN 21 1999

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Mackinac County Remonumentation Corner

SECTION

For corners in

<u>Mackinac</u>	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>1W</u>	<u>K-1</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	
	S _____ T _____ R _____	
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	
	S _____ T _____ R _____	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

RECEIVED & FILED
DIANE FRANKOVICH
MACKINAC COUNTY REGISTER OF DEEDS

DEC 31 1998
AM _____ PM _____
7|8|9|10|11|12|1|2|3|4|5|6

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Larry R. Rogers in a field survey on December 24, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-1 Northeast Corner of Section 2, Township 43 North, Range 1 West (closing corner).

Corner was originally placed in 1845 by James Mullet 23 links (15.18 feet) East of the standard corner common to Sections 35 and 36, Township 44 North, Range 1 West. The 1994 Chippewa County Remonumentation Surveyor found a P.K. nail 15.5 feet East of standard Section corner and 1.6 feet North of the South line of Section 36. The P.K. nail was destroyed by the Chippewa County Road Commission. In 1996 Ronald Bischer, P.S. 22428 found a 1/2" iron pin 15.18 feet (record falling) East of standard corner and on South line of Section 36. Bischer filed a L.C.R.C. in Liber E at Page 38 of the Mackinac County Corner Records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-1 Northeast Corner of Section 2, Township 43 North, Range 1 West (closing corner).

This corner is being perpetuated as part of the Mackinac County Remonumentation Program.

Recovered 1/2" iron and four Bischer witnesses. Accepted corner position as found and placed new monument box over corner. Corner falls approximately one foot North of the centerline of Townline Road (East-West, paved) and on the extension of centerline of County Road to South.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-1 Northeast Corner of Section 2, Township 43 North, Range 1 West (closing corner).

Corner is a 1/2" iron pin in monument box.

Witnesses:

Corner Fence Post	N37°E	37.25 feet
Telephone Splice Box	S30°E	45.13 feet
Corner Fence Post	S49°W	43.00 feet
Corner Fence Post	N47°W	57.69 feet
Standard Section Corner	West	15.18 feet

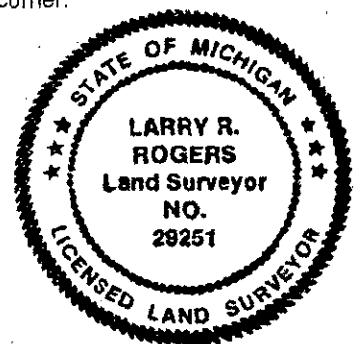

Signed by [Signature] Date 28 DEC 1998

Surveyor's Michigan License No. 29251

NOTE: Bearings are magnetic compass bearings not corrected for declination. Distances are to a nail in side of witness object unless noted.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995