

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 43 N. X. R. 6 W.	M-9, F-13, L-9
2. PROPERTY CONTROLLING IN SECTION	T. S. R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6/10, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
Corners set by H. Brevoort Jr., D.S. in 1845.

M-9 Sec. Cor. 24-25, on East boundary T43N R6W, and Sec's 19-30, T43N R5W. Bearings were: B. Ash 10, N35°E, 35 lks. and Birch 6, S81°E, 40 lks. and Birch 6, S73°W, 5 lks. and Cedar 14, N20°W, 22 lks.

F-13 Quarter corner on South side Sec. 33, T43N R6W and North quarter of Sec. 4, T42N R6W. Bearings were: Pine 22, N61°E, 30 lks. and Fir 4, N20°W, 9 lks.

L-9 Quarter corner bet. Sec's. 24-25. Bearings were: A Birch 2" for quarter section post. No witnesses.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

M-9 Found 1 1/2" pipe, iron, set by Marcus Schaaf, R.L.S. 1937. he noted finding the old witnesses.

F-13 Found corner as noted by Marcus Schaaf, R.L.S. in 1937. Placed 1" x 36" pipe at corner in East rut of North - South road.

L-9 Found 1 1/2" iron pipe set by Marcus Schaaf, R.L.S. in 1937. With witnesses noted by Schaaf. Corner lies 120' South of East-West road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Re-witnessed all three corners.

M-9 New Bearings:
8" R. Pine, N24°E, 4.4'
8" R. Pine, S45°E, 20.3'


F-13 New Bearings:
10" J. Pine, S10°E, 54.5'

L-9 New Bearings:
8" R. Pine, S48°W, 13.6'
8" R. Pine, N15°W, 20.2'

SIGNED BY: Billy D. Buckler

DATE 9/19/77

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

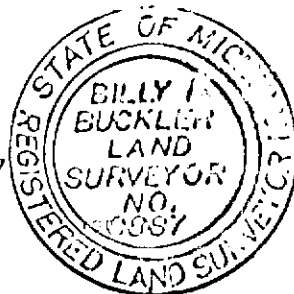

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____