

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

2 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>43</u> N. <u>X</u> , R. <u>6</u> W.	D-13, C-13
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. _____, R. _____ E. _____ S. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. _____, R. _____ E. _____ S. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7/25-26/77, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
D-13 and C-13 set by Austin Burt, D.S. June 11, 1840.

D-13 $\frac{1}{4}$ cor. on south side of Sec. 32, T43N R6W. Bearings were: Pine 18", N33°E, 20 lks. and Pine 40", N37°W, 35 lks.
 C-13 Section corner 31-32, T43N R6W. Bearings were: Cedar 4", for corner and W. Birch 7", N50°E, 32 lks.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

D-13 Corner re-established midway and on line bet. two Sec. Cors. Found no positive evidence of witnesses, however there are numerous pine stumps to West and South. Record indicate this corner found by Marcus Schaaf, R.L.S. in 1939. We could not find Mr. Schaafs location. Corner lies 55' West of stream; Record = 189.4'. River bed could have moved to West.
 C-13 Found original Cedar at corner; a stump cut 3 $\frac{1}{2}$ ' high with scribe marks on west side (T43N R6W) blaze is low on stump. Note: Closing corner, Sec's. 5-6, T42N R6W is 18.5' West of this corner. Found wood post there.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Placed 1" pipe with 4" aluminium cap at both corners.

D-13 New Bearings: 9" Cedar, N10°E, 35.8'
 8" Cedar, N79°W, 35.6'
 C-13 New Bearings: 6" Cedar, N42°E, 23.8'
 and a 6" Soft Maple, N24°W, 7.8'.

SIGNED BY Billy D. Buckler
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

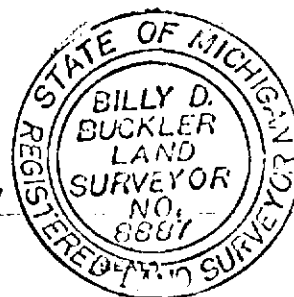

DATE 9/20/77

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____